

SSM 50578 - 2020-2021 Mustang GT500 - Lack Of Power And/Or An Illuminated MIL With DTC P1228 - Supercharger Drive Assembly Lower Level Service Part

Some 2020-2021 Mustang GT500 vehicles may exhibit a lack of power and/or an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P1228. This may be due to the one-way clutch on the supercharger drive assembly. With the supercharger belt removed, a failed one-way clutch within the pulley rotates freely in both directions. The supercharger drive assembly KR3Z-6J022-B is now available as a lower level service part, separate from the supercharger assembly. Refer to the parts catalog and Workshop Manual (WSM), Section 303-12D for installation.

APPLICABLE VEHICLES
2020 - 2021 CAR: ZG S550N MUSTANG