

**SSM 50619 - 2020-2022 F-Super Duty - 6.7L - 142/148/160/164 Inch Wheelbase - Thump/Knock Noise From The Fuel Tank After Performing TSB 21-2057 - Built On Or Before 23-Sep-2021**

Some 2020-2022 F-Super Duty pickup vehicles equipped with a 6.7L engine and built on or before 23-Sep-2021 may exhibit a thump/whine/knock noise from the fuel tank at idle or during key on, engine off (KOEO) after performing TSB 21-2057. The noise may be more pronounced at fuel levels at or below 1/4 tank. This may be due to the fuel pump. To correct the condition, replace the fuel pump and sender assembly with service part HC3Z-9H307-AR for vehicles with 160/164 inch wheelbase and a midship fuel tank, HC3Z-9H307-AQ for vehicles with 142/148 inch wheelbase and a midship fuel tank, and HC3Z-9H307-AS for vehicles with an aft of axle fuel tank. For claiming, use causal part 9H307 and applicable labor operations in Section 08 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES  
2020 - 2021 TRUCK: FE P558N SUPER DUTY  
2022 TRUCK: FE P558N SUPER DUTY