

SSM 50702 - FDRS ALERT - Anti-Lock Brake System (ABS) And Power Steering Control Module (PSCM) Programming Failures

Some 2021 F-150 vehicles may experience a Programmable Module Installation (PMI) failure of the ABS module and/or PSCM with the Ford Diagnosis and Repair System (FDRS). An ABS module PMI failure message states: Procedure Unsuccessful – Get Flash Action Part Numbers Unable To Obtain Flash Action Part Numbers. A PSCM PMI failure message states: Procedure Unsuccessful – Check For Null Part Number Part Number Is Null For: SBL. This may be due to a software issue with the FDRS and is currently under investigation. As a temporary solution, connect a battery charger to the 12v battery and perform software updates to all other available modules. When these software updates are complete, continue with PMI of the ABS module and/or PSCM.

APPLICABLE VEHICLES
2021 TRUCK: FD P702N F150