

SSM 50748 - 2020-2022 Explorer/Aviator/Police Interceptor Utility - Erratic Shift And/Or Fluid Venting - Engine Coolant In Transmission Fluid

Some 2020-2022 Explorer/Aviator/Police Interceptor Utility vehicles may exhibit erratic shifting and/or a transmission fluid venting condition. If during the preliminary inspection the transmission fluid is found to be a foamy pink color this may indicate possible cross contamination of engine coolant and transmission fluid due to an internally leaking transmission fluid cooler assembly. When repairing or replacing the transmission assembly for an internally leaking transmission fluid cooler assembly, use causal part 7869 and applicable labor operations in Section 07 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2020 - 2022 CAR: TV U611N AVIATOR
2020 - 2022 CAR: TW U625N EXPLORER
2020 - 2022 CAR: TW U625N EXPLORER