

SSM 50771 - 2020-2022 Escape/Corsair, 2021-2022 Bronco Sport, 2022 Maverick - Various Driver Assist Messages In The IPC With DTCs IPMA-U0418:86, ABS-C0051:67, PSCM-U0415:00

Some 2020-2022 Escape/Corsair, 2021-2022 Bronco Sport, 2022 Maverick vehicles may exhibit any of the following driver assistance warning messages displayed in the instrument panel cluster (IPC): Pre-collision Assist Not Available, Cruise Control Not Available, Collision Warning Malfunction and/or Adaptive Cruise Control Malfunction. Diagnostic trouble code (DTC) U0415:00 may also be stored in the power steering control module (PSCM), DTC C0051:67 stored in the anti-lock brake system (ABS) module and DTC U0418:86 stored in the image processing module A (IPMA). This may be due to the software in the power steering control module (PSCM). To correct this condition, using the latest version of Ford Diagnosis and Repair System (FDRS) scan tool. Update the PSCM to the latest software level.

APPLICABLE VEHICLES

2021 - 2022 CAR: HD CX430N C-SUV
2022 CAR: FE P758N C-PICKUP
2020 - 2022 CAR: TF CX483N CORSAIR
2020 - 2022 CAR: TC CX482N ESCAPE