

SSM 50871 - 2021-2022 Bronco - Cross Traffic System/Blind Spot System Fault In IPC - Built On Or Before 22-Mar-2022

Some 2021-2022 Bronco vehicles may exhibit a Cross Traffic System/Blind Spot System Fault in instrument panel cluster (IPC). If these symptoms are encountered, inspect the wiring under the rear bumper for chaffing of the 13A409 harness close to connector C4369. If this is determined to be the cause of the issue, refer to Wiring Diagram Cell 005 for wiring repair. If no wiring issues are found, continue with normal diagnostics in Workshop Manual (WSM), Section 419-04.

APPLICABLE VEHICLES

2021 - 2022 TRUCK: G1 U725N BRONCO