

## **SSM 50973**

### **2022 Maverick – 2.0L – Charging System Warning Indicator With DTCs U012D:00, U0284:00 And/Or U042E:00 Stored In The PCM - Built On Or Before 04-Apr-2022**

Some 2022 Maverick vehicles built on or before 4-Apr-2022 equipped with 2.0L engine may exhibit a charging system warning indicator with diagnostic trouble codes (DTCs) U012D, U0284 and/or U042E stored in the powertrain control module (PCM). The vehicle may also exhibit a malfunction indicator lamp (MIL) with DTCs P0036:00 and/or P0138:00 stored in the PCM. This may be caused by water intrusion in the connector C1050. Prior to performing Workshop Manual (WSM) diagnostics, inspect the male and/or female connector C1050 for signs of corrosion or water intrusion. If water or corrosion is found, replace the male and/or female connector C1050 with a pigtail kit and apply dielectric grease.