

## **SSM 51171**

### **2021-2022 F-150 (Non-Lightning, Non-3.5L PowerBoost) 2022 Expedition/Navigator - Illuminated ABS Indicator/Stability-Traction Control Indicator And DTC C1013:09**

Some 2021-2022 F-150 (non-Lightning and non-3.5L PowerBoost), 2022 Expedition/Navigator vehicles may exhibit an illuminated anti-lock brake system (ABS) indicator and stability-traction control indicator with diagnostic trouble code (DTC) C1013:09 stored in the ABS module. This may be due to ABS module software parameters. To correct the condition, update the ABS module to the latest software level using the appropriate scan tool. For claiming, use causal part 2005 and applicable labor operations in Section 02 of the Service Labor Time Standards (SLTS) Manual.