

## **SSM 51201**

### **2021-2022 Bronco - 2.3L - Intermittent Illuminated Brake Warning Lamp With DTC P050F In The ABS Module**

Some 2021-2022 Bronco vehicles equipped with the 2.3L engine may exhibit a red brake warning lamp and brake system warning message in the instrument panel cluster (IPC) with a diagnostic trouble code (DTC) P050F in the anti-lock brake system (ABS) module. This may be accompanied by an intermittent firm brake pedal after driving for long periods at highway speeds. This may be due to improper sealing of an internal diaphragm within a brake booster vacuum line. To correct this condition, replace the vehicle's vacuum line with the latest version service part number MB3Z-2420-H or later. Refer to Workshop Manual (WSM), Section 206-09 for installation instructions. For claiming, use casual part 2420.