

## **SSM 51374**

### **2019-2021 Various Vehicles - EBB - Illuminated ABS/Stability-Traction Control Warning Indicators With DTC U3000:96 Stored Erroneously In The ABS Module**

Some 2020-2021 Escape/Bronco Sport/Explorer and 2020-2021 Corsair/Aviator vehicles equipped with electric brake booster (EBB) built on or before 1-Aug-2022 may exhibit an illuminated anti-lock brake system (ABS) warning indicator and stability-traction control warning indicator with diagnostic trouble code (DTC) U3000:96 erroneously stored in the ABS module. This condition occurs during connection or power interrupt to the EBB module. If this code is stored and the ABS system has been reassembled, clear the DTC code using Ford Diagnosis and Repair System (FDRS) scan tool and check for recurrence. If the DTC persists, perform normal diagnostics. Refer to the Workshop Manual (WSM), Section 206-09 Anti-Lock Brake System. For claiming use the causal part number 2C219 and applicable labor operations in Section 2 of the Service Labor Time Standards.