

SSM 51578

2023 F-Super Duty (P708) (FH)

2023 F-Super Duty - Various Body Control Module (BCM) Diagnostic Trouble Codes (DTCS) When A Diagnostic Self-Test Is Performed

Some 2023 F-Super Duty vehicles may set DTCs B109F:55, B1330:9A, U0252:87, U0198:87, U0184:87, U0155:87, U0256:87, and/or U0100:87 in the BCM when a diagnostic self-test is performed. This may be due to an incorrect sequence of an internal measurement unit during self-test causing a false history status DTC (0x48 or 0x08 status). The DTC matures to history status because the BCM detects nothing is wrong. Replacement or reprogramming of the BCM will not resolve this condition. B109F:55, B1330:9A, U0252:87, U0198:87, U0184:87, U0155:87, U0256:87, and/or U0100:87 should be ignored if: no other DTCs are present in the BCM, the malfunction indicator lamp (MIL) is not illuminated while the engine is running, and no drivability concerns are present. No further service action is required.