

SSM 51591

2022 F-150 (P702) (FD)

2022 F-150 - One Or Both Headlamps Inoperative After A Performing A Body Control Module (BCM) Update With Or Without DTCs B14E5:08 and/or B14E7:08

Some 2022 model year F-150s may exhibit an inoperative headlamp after a Body Control Module (BCM) software update. There may also be BCM Diagnostic Trouble Codes (DTCs) B14E5:08 and/or B14E7:08 present. This may be due to a software incompatibility between the headlamp Light Emitting Diode (LED) control module and the BCM. If this condition occurs after a BCM software update, confirm the BCM is at the latest software level and replace the headlamp LED module on the affected headlamp. Follow Workshop Manual (WSM) procedure in Section 417-01.