

SSM 51759

2021 F-150 - Inoperative Bed Lamps With Diagnostic Trouble Code (DTC) B14D8:15 In The Body Control Module (BCM)

Some 2021 F-150 vehicles may exhibit an inoperative bed lamp with B14D8:15 stored in the BCM. This may be due to the configuration of the BCM. To correct this condition, download and run the BCM - Body Control Module (BCM) Configuration application in the Ford Diagnosis and Repair System (FDRS). For claiming, use causal part 15604 and applicable labor times in Section 10 of the Service Labor Time Standards (SLTS) Manual.