

SSM 51916 2022-2023 Expedition - Timberline - Clunk Noise On Turns

Some 2022-2023 Expedition Timberline vehicles may experience a clunk noise on turns with the steering wheel turned to full lock. This may be due to steering knuckle to control arm contact. To correct this condition, replace the steering knuckles (service part numbers NL1Z-3K185-D/NL1Z-3K186-D). Refer Workshop Manual, Section 204-01. For claiming, use casual part 3K185 and the applicable labor operations of Section 03 of the Service Labor Time Standards (SLTS) Manual.