

SSM 46324	Some 2017 F-Super Duty chassis cab and factory pickup box delete vehicles built on or before 27-Sep-2016 may exhibit an instrument panel cluster (IPC) turn signal indicator flashing fast with no inoperative turn signal lamps. This may be due to the body control module (BCM) not recognizing modified turn signal lighting which draws lower current. To correct this concern, use Integrated Diagnostic System (IDS) service tool version 103.03 or later to configure turn lamp outage settings as required. These settings can be found under toolbox > module programming > programmable parameters > exterior lighting. Vehicles built after 27-Sep-2016 have this function available but are set to outage mode during production. Use causal part 15604 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.
--------------	---