

SSM
46452

2017 F150 and Raptor vehicles equipped with a 3.5L GTDI engine may have loss of power/performance With DTC's P0244,P25B4,P0248 and P25B6. This may be caused by wastegate control actuator that is out of adjustment. Before attempting to replace any turbo charger parts. Refer to Workshop Manual(WSM), Section 303-04F wastegate control adjustment. For claiming, use causal part for 9G488 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.