



NUMBER: 05-005-03

GROUP: Brakes

DATE: Sept. 12, 2003

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

SUBJECT:

Creaking/Squeaking Sound From Brake Pedal During Actuation

OVERVIEW:

This bulletin involves lubricating the brake pedal return spring.

MODELS:

2004 (CS) Pacifica

NOTE: This bulletin applies to vehicles built on or before March 28, 2003 (MDH 0328XX).

SYMPTOM/CONDITION:

The vehicle operator may describe a creaking/squeaking sound from the brake pedal when applying the brakes during normal light to moderate braking.

DIAGNOSIS:

If the vehicle exhibits the Symptom/Condition, inspect the brake pedal return spring for presence of grease. If grease is not present or if the spring is not fully covered with grease, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
AR	05083149AA or 05083150AA	Grease, Wheel Bearing/Multi-Purpose (MS 6560) 1 tub/tube will service multiple vehicles

REPAIR PROCEDURE:

1. Access the brake pedal return spring.
2. Apply approximately 5 to 8 grams (1/8 to 1/4 oz.), of p/n 05083149AA or 05083150AA Wheel Bearing/Multi-Purpose Grease to the spring and spread evenly around the entire spring.
3. Actuate the brake pedal 5-10 times to assist the grease in penetrating within the spring coils.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
05-50-04-90	Spring, Brake Pedal Return - Lubricate	0.2 Hrs.

FAILURE CODE:

68	Noisy
----	-------