



**NUMBER:** 08-119-15

**GROUP:** Electrical

**DATE:** December 08, 2015

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-067-11, DATED DECEMBER 21, 2011, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **\*\*ASTERISKS\*\*** AND INCLUDE UPDATED LABOR OPERATION.**

***SUBJECT:***

Clockspring Replacement Due To Airbag Warning Lamp Illumination X41 (10 Year Or 150,000 Mile (240,000 Kilometers) Warranty Extension)

***OVERVIEW:***

This bulletin involves replacing the Airbag Clockspring if the Airbag Warning Lamp Is Illuminated.

***MODELS:***

2007 (JK) Wrangler

**NOTE: This bulletin applies to Left Hand Drive models only.**

***SYMPTOM/CONDITION:***

Some customers may experience the illumination of the Airbag Warning Lamp. Upon further investigation the technician may find one or more of the following Diagnostic Trouble Codes (DTCs) have been set:

- B1B00 - Driver Airbag Squib 1 Circuit Low
- B1B01 - Driver Airbag Squib 1 Circuit High
- B1B02 - Driver Airbag Squib 1 Circuit Open
- B1B03 - Driver Airbag Squib 1 Circuit Shorted Together
- B1B04 - Driver Airbag Squib 2 Circuit Low
- B1B05 - Driver Airbag Squib 2 Circuit High
- B1B06 - Driver Airbag Squib 2 Circuit Open
- B1B07 - Driver Airbag Squib 2 Circuit Shorted Together

***DIAGNOSIS:***

Using a Scan Tool (wiTECH) determine if any of the above DTCs are present. If the appropriate diagnostics available in DealerCONNECT/TechCONNECT determines that the clockspring is the cause, perform REPAIR PROCEDURE.

**NOTE: This Service Bulletin only applies to the replacement of the clockspring. All other repairs are not covered by this Service Bulletin.**

**PARTS REQUIRED:**

Qty.	Part No.	Description
AR (1)	05156106AB	Clockspring

NOTE: In some cases the **clockspring may be requested to be returned** to the Quality Return Center. Dealers are advised to follow the Warranty Parts Return Documentation procedure per the Warranty Administration Manual and hold all parts until the claim is paid and the disposition is established.

**REPAIR PROCEDURE:**

1. Replace the clockspring. Follow the detailed procedures available in DealerCONNECT > TechCONNECT > 10 - Restraints > Clockspring, removal and installation procedures.

**POLICY:**

Reimbursable within the provisions of the warranty.

**NOTE: Vehicles included in this Service Bulletin have a 10 Year or 150,000 Mile (240,000 Kilometers) Warranty for this repair. See Warranty Bulletins: U.S. D-15-23, Canada SAB-2015-20, Mexico BG-47-15, International ID-15-08 or Puerto Rico/Virgin Islands ID-15-09 for details associated with the extended warranty.**

**TIME ALLOWANCE:**

Labor Operation No:	Description	Amount
**19-85-25-A9**	Clockspring, Steering Column Control Module - Replace	0.5 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------