

FORD:

2010-2012 Transit Connect

ISSUE

Some 2010-2012 Transit Connect vehicles equipped with a 2.0L engine and built on or before 8/1/2011 may exhibit an oil leak at the oil filter seal and or the oil filter housing may be distorted.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Check the engine oil pressure, refer to Workshop Manual (WSM) Section 303-00. Is oil pressure higher than the specification listed in the WSM, Section 303-01?
 - a. Yes - Proceed to Step 2.
 - b. No - This procedure does not apply. Refer to WSM, Section 303-00 for normal diagnostics.
2. Remove the valve cover, refer to WSM, Section 303-0. Check the oil drain back passages for sludge. Is sludge present?
 - a. Yes - This procedure does not apply.
 - b. No - Proceed to Step 3.
3. Replace the oil pump and oil cooler with revised parts, refer to WSM, Section 303-01.
4. Install valve cover, refer to WSM, Section 303-01.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage
 Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB.
 Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

OPERATION	DESCRIPTION	TIME
120103A	2010-2012 Transit Connect: Check Engine Oil Pressure, Inspect Oil Drain Passages, Replace The Engine Oil Cooler And Oil Pump (Do Not Use With Any Other Labor Operations)	5.3 Hrs.

DEALER CODING

BASIC PART NO.
6600

CONDITION CODE
42

OASIS CODES: 200000
 , 206000
 , 400000
 , 401000

PART NUMBER	PART NAME
CM5Z-6600-A	Oil Pump
1S7Z-6A642-AAA	Oil Cooler

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.