

LINCOLN:
2012 MKS

ISSUE

The windshield wiper pivots on some 2012 MKS vehicles built on or before 2/5/2012 may chafe the 14290 harness. Driveability symptoms may indicate this condition exists.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Remove the cowl panel grill, refer to Workshop Manual (WSM), Section 501-02.
2. Inspect the 14290 harness for possible chaffing at the windshield wiper pivots.
 - a. If harness is not damaged, this article does not apply.
 - b. If harness is damaged at the wiper pivots proceed to Step 3.
3. Repair harness damage following wiring repair guidelines found in the Wiring Diagrams cell 5-1.
4. Secure harness to the retention features in the cowl area. (Figure 1)



Figure 1 - Article 12-5-9

5. Install the cowl panel grill, refer to WSM, Section 501-02.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

TSB 12-5-9 (Continued)

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage. Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

OPERATION	DESCRIPTION	TIME
120509A	2012 MKS: Inspect And Repair Wire Harness Includes Time To Remove And Install The Cowl Panel Grill (Do Not Use With Any Other Labor Operations)	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14290	30