

**LINCOLN:**  
2013 MKZ

**ISSUE**

Some 2013 MKZ vehicles built on or before 3/6/2013 may exhibit various drivability symptoms including a crank no start with diagnostic trouble code (DTC) U0109 stored in the powertrain control module (PCM).

**ACTION**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Remove the left hand (LH) C-pillar lower trim panel. Refer to Workshop Manual (WSM), Section 501-05.
2. Remove G304 fastener and discard. Refer to Wiring Diagram, Section 10-1. (Figure 1)
3. Install new fastener. Torque to 12 N•m (9 lb-ft).
4. Install LH C-pillar lower trim panel. Refer to WSM, Section 501-05.
5. Clear DTCs.

PART NUMBER	PART NAME
W505255-S450L	Bolt



Figure 1 - Article 13-5-26

**WARRANTY STATUS:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage. Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**NOTE:** The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

## TSB 13-5-26 (Continued)

<b>OPERATION</b>	<b>DESCRIPTION</b>	<b>TIME</b>
130526A	2013 MKZ: Check DTCs And Replace Ground Fastener Includes Time To Remove And Install Trim Panels And Clear Codes (Do Not Use With Any Other Labor Operations)	0.4 Hr.

  

<b>DEALER CODING</b>		<b>CONDITION</b>
<b>BASIC PART NO.</b>		<b>CODE</b>
5427841		42