

**3.7L WITH ADAPTIVE CRUISE CONTROL - DTC P061A - BUILT ON OR AFTER 2/6/2012 AND THROUGH 10/17/2013****TSB 13-12-16****LINCOLN:**

2013-2014 MKS

**ISSUE**

Some 2013-2014 Lincoln MKS vehicles equipped with the 3.7L engine and adaptive cruise control built on or after 2/6/2012 and through 10/17/2013 may exhibit a malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P061A that may be setting during low speed maneuvers below 32 Km/h when the instrument cluster is set to metric units.

**ACTION**

Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 87.03 and higher. Calibration files may also be obtained at [www.motorcraft.com](http://www.motorcraft.com).

**NOTE:**

PLEASE ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

<b>OPERATION</b>	<b>DESCRIPTION</b>	<b>TIME</b>
131216A	2013-2014 MKS 3.7L Ti-VCT: Check DTCs And Reprogram The PCM Includes Time To Clear Codes (Do Not Use With Any Other Labor Operations)	0.3 Hr.

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage  
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

<b>BASIC PART NO.</b>	<b>CONDITION CODE</b>
RECALEM	04

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.