

**ENERGI - LACK OF 120V/240V HIGH VOLTAGE BATTERY CHARGING  
AND DTCS P0D08 AND/OR P0D0F****TSB 13-12-23****FORD:**

2013 C-MAX

2013-2014 Fusion

This article supersedes TSB **13-9-13** to update the vehicle model years.

**ISSUE**

Some 2013 C-MAX Energi and 2013-2014 Fusion Energi vehicles built on or before 10/14/2013 may fail to charge the high voltage battery using either 120 volt Level-1 Electric Vehicle Service Equipment (EVSE) or 240V Level-2 EVSE. Diagnostic trouble codes (DTCs) P0D08 and/or P0D0F will be present in the battery energy control module (BECM).

**ACTION**

Reprogram the BECM to the latest calibration using IDS release 87.01 and higher. Calibration files may also be obtained at [www.motorcraft.com](http://www.motorcraft.com).

At the Module Reprogramming screen in the IDS service tool, select Program PCM. By selecting the PCM the update will be applied to the appropriate modules as required by the software update.

<b>OPERATION</b>	<b>DESCRIPTION</b>	<b>TIME</b>
131223A	2013 C-MAX, 2013-2014 Fusion Energi: Reprogram The Appropriate Modules As Required By The Software Update Includes Time To Clear Codes After Repair (Do Not Use With Any Other Labor Operations)	0.5 Hr.

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

<b>BASIC PART NO.</b>	<b>CONDITION CODE</b>
10B687	04

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.