

2.0L - COOLANT LEAK AT THE RADIATOR SIDE TANK SEAMS - BUILT ON 9/15/2011 AND THROUGH 8/20/2012**TSB 14-0110****FORD:**

2012 Transit Connect

ISSUE

Some 2012 Transit Connect vehicles equipped with a 2.0L engine and built on 9/15/2011 and through 8/20/2012 may exhibit a coolant leak from the left or right radiator side tank seams. This may be due to a leaking gasket between the tank and the radiator core.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Visually inspect the radiator side tanks for evidence of a coolant leak. Is the left or right tank of the radiator leaking?
 - a. No - this article does not apply. Refer to Workshop Manual (WSM), Section 303-03 for normal diagnosis.
 - b. Yes - replace the radiator. Refer to WSM, Section 303-03.

PART NUMBER	PART NAME
9T1Z-8005-B	Radiator
VC-3-B	Motorcraft® Orange Antifreeze/Coolant Concentrated

OPERATION	DESCRIPTION	TIME
140110A	2012 Transit Connect: Inspect And Replace The Radiator (Do Not Use With Any Other Labor Operations)	1.5 Hrs.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
8005	D8

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.