



To All Lamborghini Dealers and Licensed Service Point  
From Customer Service Department  
Subject Service campaign – Fixing of Gallardo Shock Absorbers Covers  
Group 140.4.11.00.05 (front) and 140.5.12.00.05 (rear)  
Date 18.07.2005  
Pages 7

Automobili  
Lamborghini S.p.A.

### **Subject**

Fixing of the Gallardo shock absorbers protection covers.

### **Model / VIN-Range**

All Gallardo models until VIN ZHWG\_11\_\_5LA02579

### **Information to the field**

In case you have a vehicle in the workshop, Lamborghini recommends fixing the shock absorbers protection covers.

This modification must be performed on all cars involved at the next service.

Lamborghini recommends carrying out this upgrade aiming to extend the life of these components.

Important remark: on cars equipped with Lifting System this rework must be performed only on the rear shock absorbers

### **Field solution**

Fix shock absorbers protection covers in the right position with glue.

### **Spare Parts**

No spare parts needed.

1-7

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.

Via Modena,12  
I-40019 Sant'Agata  
Bolognese  
Tel +39 051 6817 652  
Fax +39 051-6817 709



## Warranty Claim data

This can be found on Lamborghini Web Portal in the Warranty section  
“Available campaigns”.

### Cars not equipped with Lifting System:

Campaign Code: L140-A.07.05  
Campaign Description: Fixing shock absorbers covers (no Lifting System cars)  
Cost Code: 50  
Component Code: CCA0705  
Trouble Code: 220  
Labour Code: CCA0705100  
Labour Time: 1.5 h

Maximum sublet for material: 10 €/ 13\$/ 1870Yen

### Cars equipped with Lifting System:

Campaign Code: L140-A.08.05  
Campaign Description: Fixing shock absorbers covers (Lifting System cars)  
Cost Code: 50  
Component Code: CCA0805  
Trouble Code: 220  
Labour Code: CCA0805100  
Labour Time: 0.8 h

Maximum sublet for material: 10 €/ 13\$/ 1870Yen

Your Area Manager is at your full disposal for further information.

Best regards

Product Service

---

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



## Necessary material

3M™ Scotch-Weld™ Structural Plastic Adhesive DP8005 Translucent Duo-Pak, 38ml (please contact the local 3M dealer – [www.3m.com](http://www.3m.com) for more information).

### Contains:

- Gun 568 applicator – manual – EPX
- Nozzle MMS 40035 for 8005 – DP 4000 – 10:1
- Plunger MMS 4000 for 8005 – EPX - 10:1
- Glue MMS 8005 – DP Scotch Weld – MC 38



---

*The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.*



## Description of operations

**Important remark:** on cars equipped with Lifting System the following operations must be performed only on the rear wheels/shock absorbers.

1.1 Adopt all precautions to prevent car damages and to work safe.

1.2 Remove all the wheels

1.3 Remove all the rock panels

1.4 Identify the black protection cover (pictures 1, 2) and check the protection cover position.


Correct position:





Not correct position:


Picture 2

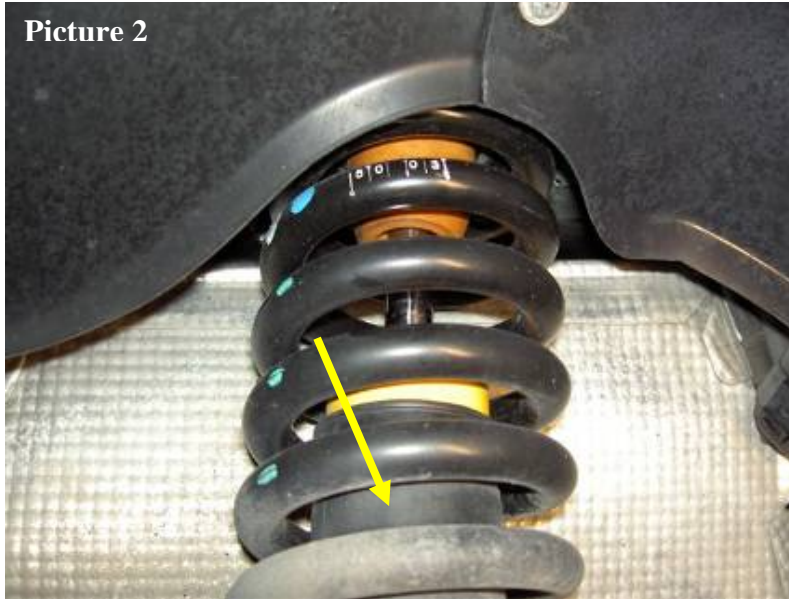

**1.5** If the cover is in the correct position (pic.1), remove it from its upper fixing point, using a screw driver (pic. 3), in order to carry out the rework and go to operation 1.6.


If the cover is in a not correct position (pic.2) go to operation 1.6.

Picture 3

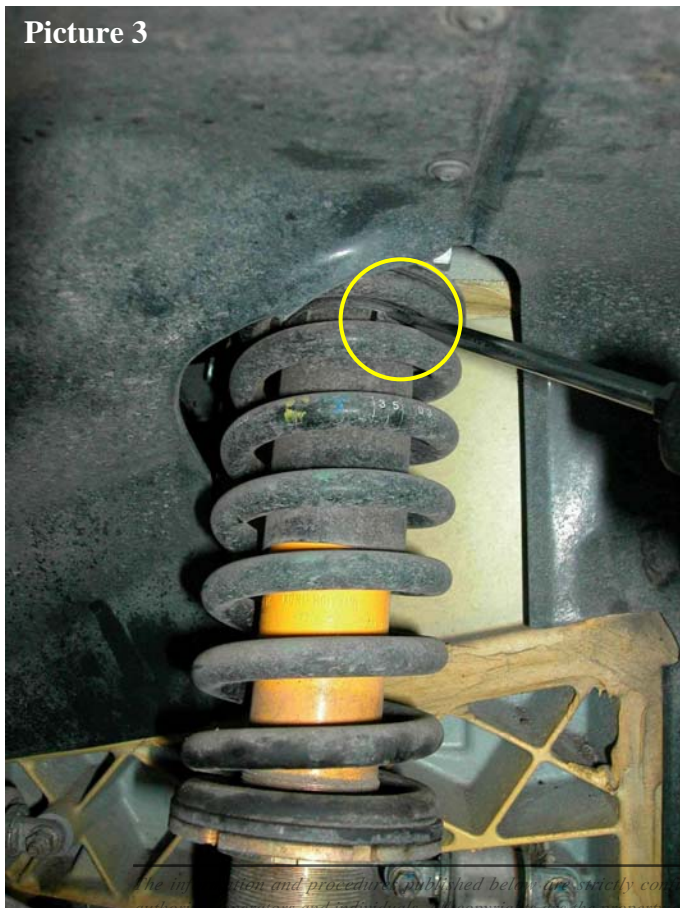



**1.6** Using the glue gun, apply the glue in four points to block the protection (use the gloves when operating the glue). (picture 4)

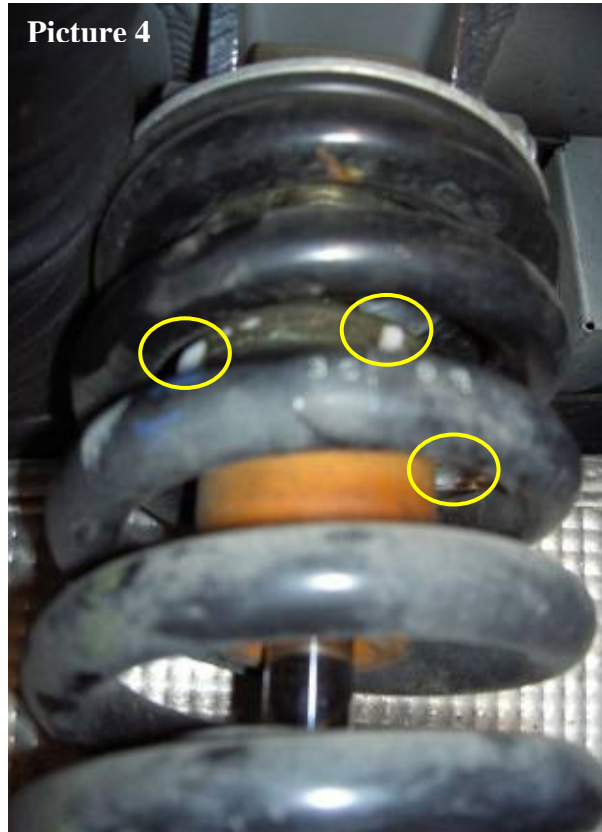

**1.7** Now you can lift up the black cover. Use two screw drivers to lift up and fit in the cover.

**1.8** After fitting in the protection, apply other 4 points of glue between the protection and the fixing point. (Picture 5 indicated with yellow).



**1.9** Then use the screw driver to spread the glue. (Picture 5)



**1.10** Please consider that the glue needs about 7/8 hours to fix the parts.