



To All Lamborghini Dealers and Licensed Service Point
From Customer Service Department
Subject Evaporative emission control sensor position and P-Codes
Group 140.2.03 and 140.0.91
Attachments -
Date 20.10.2005
Pages 2

Automobili
Lamborghini
S.p.A.

Subject

Evaporative emission control pressure sensor positioning and P-Codes

Model / VIN-Range

All models Gallardo and Murciélago

Information to the field

In case you have a car in the workshop with the LDAS acquisition showing the fault code **P0450** (Evaporative emission control system: Pressure sensor malfunction) please check if the positioning of the pressure sensor (p.n. 400906206) inlet pipe is correct before replacing the sensor.


The correct pipe positioning is shown in the picture below (the picture refers to Gallardo but the pipe positioning is the same also for Murciélago).

If the pipe is not correctly positioned, reconnect it like shown in the picture and repeat the LDAS acquisition.

Your Area Manager is at your full disposal for further informations.

Best regards

Customer Service

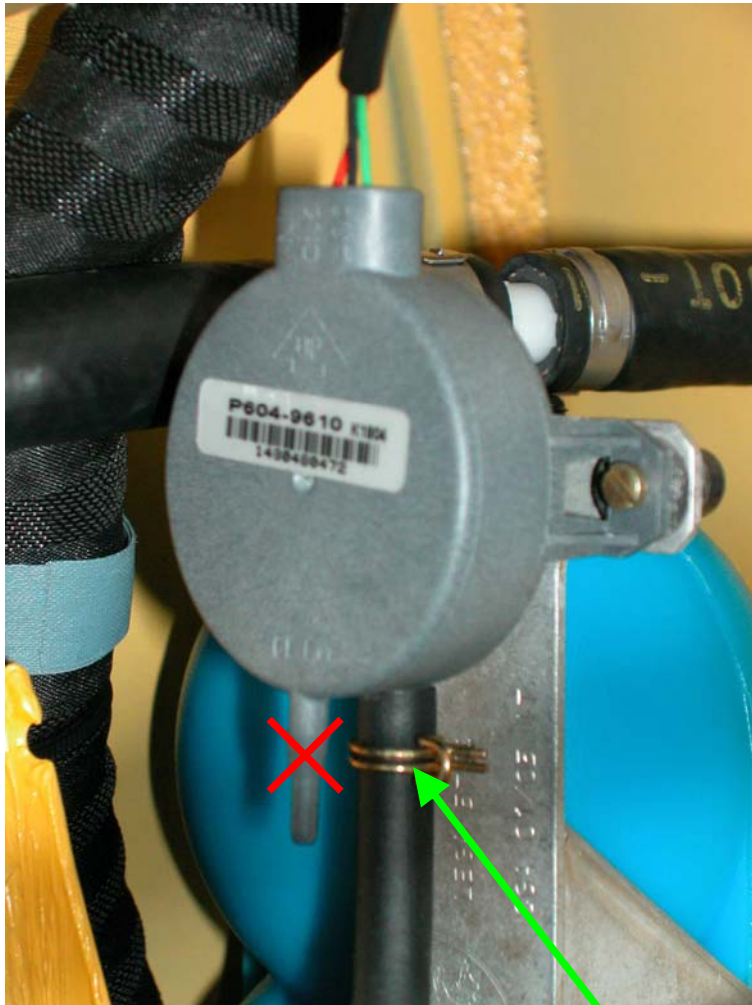

Correct positioning of the pressure sensor inlet pipe.