

FORD:

2015 Transit

ISSUE

Some 2015 Transit vehicles equipped with a 3.5L or 3.7L engine may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0627 (Fuel Pump A Control Circuit/Open) stored in powertrain control module (PCM) memory.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Connect the Ford Integrated Diagnostic System (IDS) service tool or equivalent scan tool to the data link connector (DLC). Check for DTCs. Is P0627 stored in the PCM memory?
 - a. Yes - replace the fuel pump driver module (FPDM). Refer to Workshop Manual (WSM), Section 303-04.
 - b. No - this article does not apply. Refer to Powertrain Control/Emissions Diagnosis (PC/ED) manual for normal diagnostics.
- 2.

PART NUMBER	PART NAME
AA8Z-9D370-B	Fuel Pump Driver Module

OPERATION	DESCRIPTION	TIME
170011A	2015 Transit 3.5L /3.7L: Retrieve DTCs And Replace The FPDM (Do Not Use With Any Other Labor Operations)	0.4 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9D370	42

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.