



**NUMBER:** 18-004-06 REV. A

**GROUP:** Vehicle Performance

**DATE:** March 1, 2006

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.*

**THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 18-004-06, DATED JANUARY 26, 2006, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **\*\*ASTERISKS\*\*** AND INCLUDE ADDITIONAL MODEL YEARS AND PARTS APPLICATIONS.**

**THE DRBIII® FLASH FILES FOR THIS BULLETIN ARE AVAILABLE ON DealerCONNECT.**

**FOR MARKETS OUTSIDE OF THE UNITED STATES AND CANADA, THE FLASH FILES AND REPROGRAMMING INSTRUCTIONS WILL BE AVAILABLE ON ITIL/ISIS DVD APRIL, 2006.**

***SUBJECT:***

Flash - No Start Or Hard Start

***OVERVIEW:***

This bulletin involves replacing the Idle Air Control Motor (IAC) and selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software.

***MODELS:***

**\*\*2004 - 2006\*\*** (CS) Pacifica

**NOTE: **\*\*This bulletin applies to 2004 models equipped with a 3.5L engine (sales code EGN) built after July 12, 2003 (MDH 0712XX), all 2005 CS vehicles equipped with a 3.5L or 3.8L engine (sales code EGN or EGH), and 2006 CS vehicles equipped with a 3.5L engine (sales code EGN) built prior to February 28, 2006 (MDH0228XX).\*\*****

***SYMPTOM/CONDITION:***

Vehicle may exhibit a no start or hard start without throttle assist, more noticeable at cold temperatures below 0° C (32° F).



**Stick with the Specialists™**

**DIAGNOSIS:**

Using a Scan Tool (DRBIII®) with the appropriate diagnostic procedures on TechCONNECT, verify all engine systems are functioning as designed. If DTCs are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the Symptom/Condition is present, perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification
1	04861325AD	Idle Air Control Motor (IAC) 2004 3.5L & 2005 3.8L Application
1	**04861625AB**	**Idle Air Control Motor (IAC) 2005 & 2006 3.5L Application**

**SPECIAL TOOLS/EQUIPMENT REQUIRED:**

NPN	Battery Charger
CH2002	General Purpose Interface Bus Cable Assembly
CH6000A	Scan Tool (DRBIII®)
CH7000A/7001A	J1962 Cable with red DRBIII® connector
	TechCONNECT Workstation

**NOTE: An updated J1962 cable has been released. This cable has a red colored connector at the DRBIII® connection. Use this cable whenever a flash is being performed.**

**REPAIR PROCEDURE:**

1. Replace the idle air control motor (IAC) using the information available in TechCONNECT, refer to 14 - Fuel System/Fuel Injection/Idle Air Control Motor - removal/Installation procedures.

**NOTE: Whenever a controller is programmed, the software in the DRBIII®; must be programmed with the latest revision level available.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted and then follow the directions on the DRBIII®.**


2. Before beginning the reprogramming procedure, remove any old flash reprogramming files from the DRBIII® memory. To clear the memory from the MAIN MENU:
  - a. Simultaneously press the "MORE" and "YES" keys.
  - b. A screen will appear requesting a "COLD BOOT".
  - c. Follow the on screen instructions by selecting the "F4" key.
  - d. When the DRB III® reboots to the MAIN MENU, proceed to [Step #3](#)

3. With the ignition switch in the "RUN" position, determine the original part number of the PCM currently in the vehicle. Using the DRBIII® select:
  - a. "DRBIII® Standalone"
  - b. "1998 - 2005 Diagnostics"
  - c. "All (Except Below)"
  - d. "Engine"
  - e. "Module Display"
  - f. Record the "PCM part #" on the repair order for later reference.
4. Connect the DRBIII® to TechCONNECT. Open TechTOOLS and verify that the "DRBIII® Status: Connected" message is in the upper right corner of the TechTOOLS screen.
5. Enter the "PCM part #" recorded in [Step #3](#) in the "Parts Criteria" area and select "Show Updates". TechTOOLS will populate the appropriate calibration.
6. Select the calibration.
7. Select the "DRBIII" radio button which is next to the "Download/Update" button.
8. Select the "Download/Update" button.
9. Monitor the "Flash Download/Update Progress" window on the TechCONNECT and follow the instructions on TechCONNECT. When the flash process is complete, proceed to [Step #10](#).
10. **Disconnect the DRBIII® from TechCONNECT.**
11. Open the hood, install a battery charger and verify that charging rate provides approximately 13.5 volts.
12. Connect the DRBIII® to the vehicle.
13. Download the flash from the DRBIII® to the vehicle. Using the DRBIII® select:
  - a. "Vehicle Flash"
  - b. Follow the directions on the DRBIII® screen. When the flash process is complete, proceed to [Step #14](#).

**NOTE: Due to the PCM programming procedure, a DTC may be set in other modules (TCM, BCM, MIC, SKIM, etc.) within the vehicle, if so equipped. Some DTC's may cause the MIL to illuminate. Check all modules using "Module Scan", record the DTC's, and erase these DTC's prior to returning the vehicle to the customer. Erase any DTC's in the PCM only after all other modules have had their DTC's erased.**

**NOTE: The following step is required by law.**

14. Type the necessary information on the "Authorized Modification Label" p/n 04275086AB and attach near the VECI label ([Fig. 1](#)).

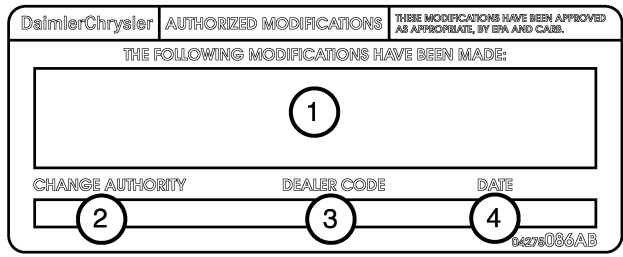

80f34528

**Fig. 1 AUTHORIZED MODIFICATION LABEL**

- 1 - POWERTRAIN CONTROL MODULE P/N (INSERT P/N) USED
- 2 - CHANGE AUTHORITY: TSB XX-XXX-XX
- 3 - DEALER CODE: XXXXX
- 4 - DATE: XX-XX-XX

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Amount
14-30-23-90	Replace Idle Air Control Motor and Reprogram Powertrain Control Module	0.7 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------