



GROUP
Chassis

MODEL
Sedona (GQ)

NUMBER
016

DATE
April 2007

TECHNICAL SERVICE BULLETIN

SUBJECT:

SEDONA (GQ) BRAKE PAD AND BRAKE DISC

This service bulletin provides information regarding a brake judder or vibration felt when braking in a small percentage of 2004 & 2005MY Sedona (GQ) vehicles. These vehicles were produced between 12/5/2003 and 11/1/2005. In the event a customer reports this condition, both the front brake pads and discs should be replaced with new parts.

PARTS REQUIRED:

1) Front brake pad

	OLD	NEW	QTY
Material	KBP 6052 (Non-steel)	KBP ES35 (Semi-metal)	—
Part Number	4K52Y 3323Z	4K52Y 3323ZFFF	1

2) Front brake disc

	OLD	NEW	QTY
Material	FCH1	FC250D	—
Part Number	4K52Y 33251	4K52Y 33251FFF	2

WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Time	Related Parts	Qty.
W	4K52Y 3323Z 4K52Y 33251	0 0	N21	C09	Brake pad & disc replacement	51712F00	0.9	4K52Y 3323ZFFF 4K52Y 33251FFF	1 2

N21: Shuddering, Vibration, C09: Deformed

File Under: Chassis

Circulate To: ☒ General Manager ☒ Service Manager ☒ Parts Manager
☒ Service Advisor(s) ☒ Technician(s) ☒ Body Shop Manager ☐ Fleet Repair