

NUMBER: 23-006-07

GROUP: Body

DATE: February 9, 2007

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 23-035-06, DATED AUGUST 24, 2006, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS** AND INCLUDE CLEAN POINT CHANGES.

SUBJECT:

Buzz/Rattle Like Sound In Rear Quarter Panel Speaker Area With or Without The Radio On

OVERVIEW:

This bulletin involves cutting a tab off of the rear quarter trim panel so that the tab cannot contact the rear speaker grille on both sides of the vehicle.

MODELS:

2005 - 2007 (RS) Town & Country/Caravan

2005 - 2007 (RG) Chrysler Voyager (International Markets)

NOTE: **This bulletin applies to vehicles built on or after June 1, 2004 (MDH 0601XX) through January 1, 2007 (MDH 0101XX).**

SYMPTOM/CONDITION:

Buzz/Rattle like sound in the rear guarter panel speaker area with or without the radio on.

DIAGNOSIS:

If the Symptom/Condition is present, perform the Repair Procedure.

REPAIR PROCEDURE:

- Remove the left quarter trim bolster over the speaker. Refer to the detailed service information available in TechCONNECT, under: Service Info, 23 -Body/Interior/Quarter Trim Bolster - Removal.
- 2. Locate the tab on the quarter trim panel. Cut the tab off of the trim panel so that it cannot contact the speaker grille (Fig. 1).



23-006-07 -2-

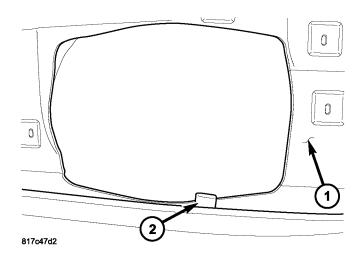


Fig. 1 TAB ON QUARTER TRIM PANEL

- 1 REAR QUARTER TRIM PANEL
- 2 TAB TO BE CUT OFF
- Install the rear quarter trim bolster over the speaker.
 Repeat Step #1 through Step #3 on the right side of the vehicle.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-20-54-91	Panel, Quarter Trim Bolster & Speaker Grille - Remove Tab - Both Sides (C)	0.2 Hrs.

FAILURE CODE:

ZZ Service Action	
-------------------	--