

May 23, 2015

01882 Version 1

## Front Brake Judder

### AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2012-14	CR-V	2WD	ALL

### SYMPTOM

The front brakes shake or judder when the brakes are applied.

### POSSIBLE CAUSES

The brake pad, disc, and caliper are misaligned when the brakes are applied.

### CORRECTIVE ACTION

Install new brake pads.

### PARTS INFORMATION

Part Name	Part Number	Quantity
Front Brake Pad Set	45022-TR7-A02	1

### TOOL INFORMATION

Part Name	Tool Number	Quantity
Brake Caliper Piston Compressor	07AAE-SEPA101	1

### WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
410820	Resurface the front brake discs and replace the front brake pads.	0.9 hr	15-030A	45022-SCV-A00

Defect Code: 00504

Symptom Code: 03503

Skill Level: Repair Technician

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

## REPAIR PROCEDURE

1. With the vehicle on a lift, remove both front wheels.
2. Resurface both front brake discs. Refer to the electronic service manual.
3. Replace the front brake pads. Refer to the electronic service manual.
4. Reinstall all removed parts in the reverse order of removal.
5. Reinstall the front wheels and torque them to **108 N·m (80 lb-ft)**.

END.