
June 25, 201501960 Version 2

MIL Comes On With DTC P0088

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2015	Accord	L4 only	ALL except Hybrid

SYMPTOM

The MIL comes on with DTC P0088 (fuel rail pressure too high).

POSSIBLE CAUSES

The actual fuel pump pressure is too high for the current PGM-FI software.

CORRECTIVE ACTION

Update the PGM-FI software.

SOFTWARE INFORMATION

NOTE: Unnecessary or incorrect repairs resulting from a failure to update the HDS or MVCI are not covered under warranty.

MVCI Control Module (CM) Update:

Application (FW) Version **3.01.40 or later**

Database Update **25-May-2015 or later**

HDS Software Version:

3.016.023 or later

Before beginning the repair, make sure that both the HDS and the MVCI are updated as listed above.

Do only the update listed in this service bulletin.

Check that the MVCI indicates the applicable program ID listed below (or a later program ID) as the **Available Update** when the update begins.

If the MVCI displays, **This vehicle does not need an update at this time** during the update, the software for this bulletin is already installed.

For more information about updating the HDS, the MVCI, and vehicle systems, refer to Service Bulletin 01-026, *Updating Control Units/Modules*.

<p>CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.</p>
--

Year/Model/Trim	Program ID (or later)	Program P/N (or later)
2015 Accord 4-door with CVT, LX	A0A540	37805-5A0-A54
2015 Accord 4-door with CVT, EX, EX-L, EX-L Navi	A0A640	37805-5A0-A64
2015 Accord 2 and 4-door with CVT, LX-S, Sport	A0A740	37805-5A0-A74
2015 Accord 2-door with CVT, EX, EX-L, EX-L Navi	A0A840	37805-5A0-A84
2015 Accord 4-door with CVT, LX	A1L540	37805-5A1-L54
2015 Accord 4-door with CVT, EX, EX-L, EX-L Navi	A1L640	37805-5A1-L64
2015 Accord 2 and 4-door with CVT, LX-S, Sport	A1L740	37805-5A1-L74
2015 Accord 2-door with CVT, EX, EX-L, EX-L Navi	A1L840	37805-5A1-L84
2015 Accord 2 and 4-door with M/T, LX, LX-S, Sport	A0A040	37805-5A0-A04
2015 Accord 2 and 4-door with M/T, EX	A0A140	37805-5A0-A14
2015 Accord 2 and 4-door with M/T, LX, LX-S, Sport	A0L040	37805-5A0-L04
2015 Accord 2 and 4-door with M/T, EX, EX-L, EX-L Navi	A0L140	37805-5A0-L14

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
125517	Update the PGM-FI software.	0.2 hr	15-036A	37820-5A0-A63

Defect Code: 03214

Symptom Code: 03203

Skill Level: Repair Technician

REPAIR PROCEDURE

Update the PGM-FI software with the MVCI. Refer to Service Bulletin 01-023, *Updating Control Units/Modules*.

END