

**Introduction** On some ECHO, Scion xA, and Scion xB vehicles, a condition may exist that allows the evaporator drain hose to become detached, causing the passenger foot well to become wet. This bulletin provides a procedure to correct this condition.

- Applicable Vehicles**
- **2003 - 2005** model year **ECHO** vehicles produced **BEFORE** the Production Change Effective VIN shown below.
  - **2004 - 2006** model year **Scion xA** and **xB** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

**Production  
Change  
Information**

| MODEL    | PRODUCTION CHANGE EFFECTIVE VIN |
|----------|---------------------------------|
| ECHO     | JTDBT1#3#50394522               |
| Scion xA | JTKKT6#4#60131993               |
| Scion xB | JTLKT3#4#64033143               |

**Parts  
Information**

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME            | QTY |
|----------------------|---------------------|----------------------|-----|
| N/A                  | 88899-52150         | Clamp, Cooler, No. 3 | 1   |

**Warranty  
Information**

| OP CODE | DESCRIPTION          | TIME | OFF         | T1 | T2 |
|---------|----------------------|------|-------------|----|----|
| AC5004  | Cooler Clamp Install | 0.5  | 88501-52080 | 64 | 55 |


**Applicable Warranty\*:**

**This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.**


\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

**Repair  
Procedure**


1. Inspect the evaporator drain hose to ensure that it is the cause of the water leak. If the evaporator hose is out of position, continue with this procedure.

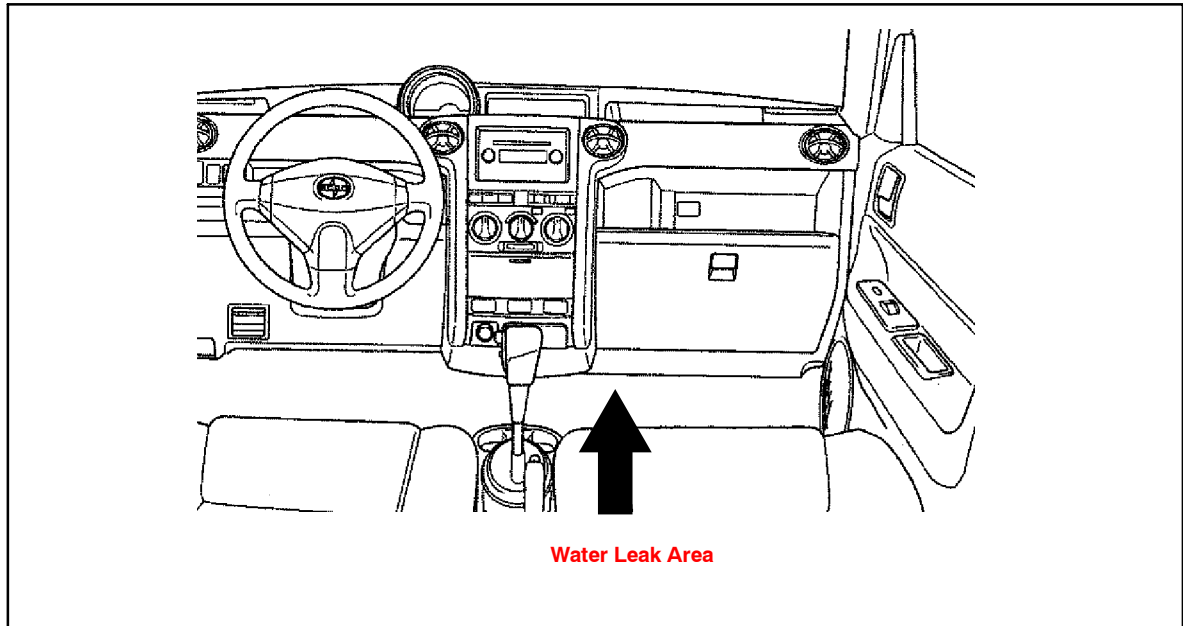

2. Install the retaining clamp on the drain hose.

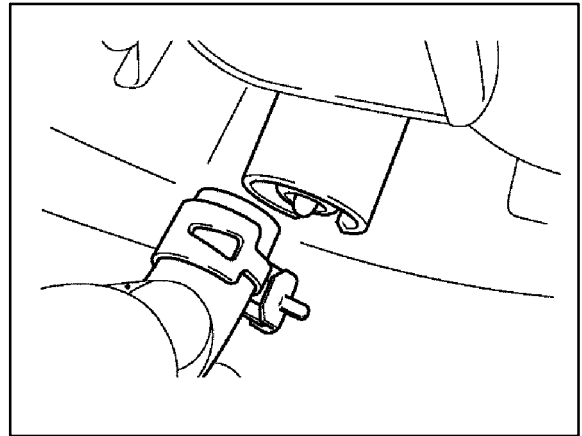

3. Push the drain hose up onto the evaporator drain tube. Ensure that the drain hose is up far enough for the retaining clamp to fully engage the tube.

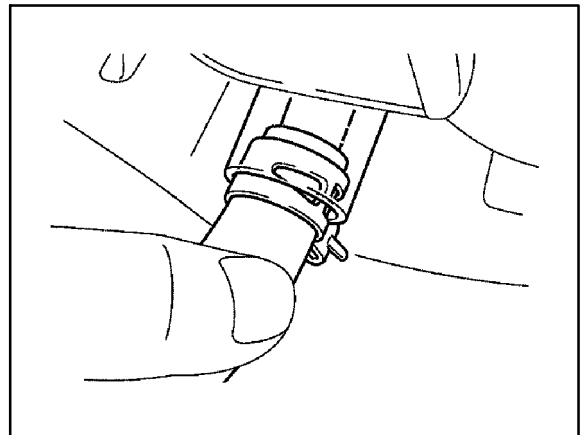

**Repair  
Procedure**  
(Continued)

4. Release the holding clip.

