

# Service Bulletin



Applies To: 2000–01 3.5RL – ALL December 3, 2001

2002 3.5RL - From VIN JH4KA9 ... 2C000001 thru JH4KA9 ... 2C009442

# **Hesitation or Stall at Very Low Speeds**

### **SYMPTOM**

The vehicle may hesitate or possibly stall during very light acceleration when the throttle is opened gradually at extremely low speeds (walking speed). The engine can be immediately restarted. Recurrence is very rare because it requires a unique combination of driving mode, ambient conditions, and gasoline characteristics to exist simultaneously. A customer may describe only experiencing the symptom one time.

# **PROBABLE CAUSE**

A PCM malfunction.

#### **CORRECTIVE ACTION**

Replace the PCM with an updated unit.

# PARTS INFORMATION

Powertrain Control Module (PCM):

2000–01: P/N 37820-P5A-308 2002: P/N 37820-P5A-A37

#### **WARRANTY CLAIM INFORMATION**

In warranty: The normal warranty applies.

Operation Number: 121100 Flat Rate Time: 0.4 hour

Failed Part: 37820-P5A-A34 (2000-01)

37820-P5A-A35 (2002)

Defect Code: 093 Contention Code: C05

Template ID: 01-044A (2000–01)


01-044B (2002)

Skill Level: Repair Technician


**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

# **REPAIR PROCEDURE**

- 1. Remove the passenger's side door sill molding and right kick panel, and pull back the carpet.
- 2. Remove the PCM cover (four nuts).

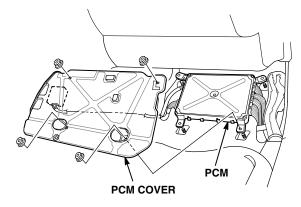

- 3. Remove the PCM. Disconnect the electrical connectors.
- Connect the electrical connectors to the new PCM, and install the new PCM.
- 5. Reinstall the PCM cover. Torque the mounting nuts to 9.8 N·m (7.2 lb-ft).
- 6. Reinstall the carpet and the door sill molding.
- Connect the PGM Tester to the data link connector. Make sure the PGM Tester has software version SN 201 or later.

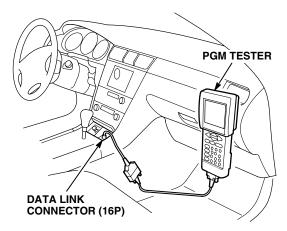

- 8. Select #5 (IMMOBI) from the MAIN menu.
- 9. From the IMMOBI menu, select #1 (REWRITE).
- 10. From the REWRITE menu, select #2 (ECM) and continue to follow the screen prompts.

© 2001 American Honda Motor Co., Inc. - All Rights Reserved

BTB 23350 (0112)

1 of 1

