



Inside Rearview Mirror Is Loose

(Supersedes 06-012, dated April 14, 2006, to revise the information marked by the black bars)

REVISION SUMMARY

Under VEHICLES AFFECTED, the model year range for the TL was changed to all 2004–08 models.

SYMPTOM

The rearview mirror is loose at the windshield, allowing it to vibrate while driving.

PROBABLE CAUSE

The mounting spring inside the mirror bracket is deformed.

VEHICLES AFFECTED

2001–03 CL – ALL

2001–03 MDX – ALL

1999–03 3.2TL – ALL

2004–08 TL – ALL

CORRECTIVE ACTION

Replace the mounting spring.

PARTS INFORMATION

Mounting Spring: P/N 76419-SZ3-J05

TOOL INFORMATION

KTC Trim Tool Set: T/N SOJATP2014

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 828145

Flat Rate Time: 0.4 hour

Failed Part: P/N 76419-SZ3-J05

Defect Code: 06201

Symptom Code: 04501

Template ID: 06-012A


Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the rearview mirror from the windshield.
 - Refer to the Body section of the appropriate service manual, or
 - Online, enter keyword **MIRROR**, and select **Automatic Dimming Rearview Mirror Replacement or Rearview Mirror Replacement** from the list.

2. Remove the screw and the spring from the mirror bracket.

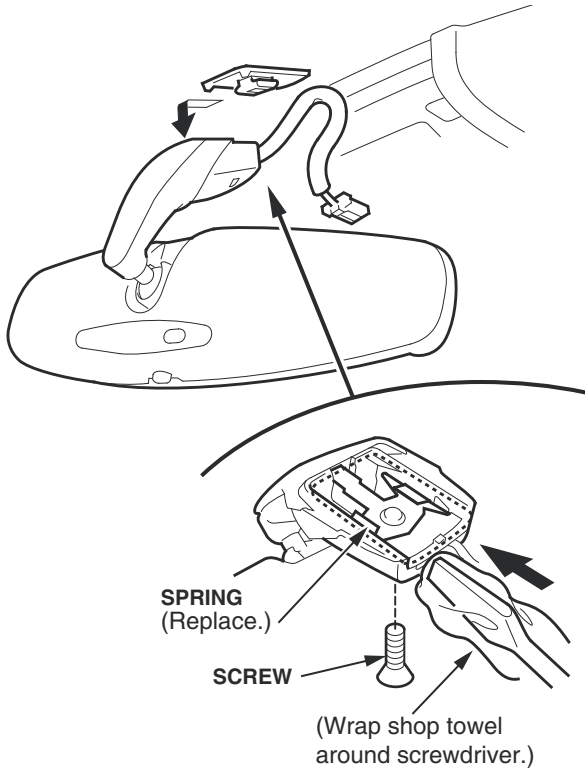

3. Install the new spring to the mirror bracket. The spring must be seated all the way down when you tighten the screw. Make sure the wiring harness is not pinched.
4. Reinstall the rearview mirror to the windshield.
 - Refer to the Body section of the appropriate service manual, or
 - Online, enter keyword **MIRROR**, and select **Automatic Dimming Rearview Mirror Replacement or Rearview Mirror Replacement** from the list.