

February 18, 2015

01328-01525 Version 3

Product Update: Cross-Traffic Monitoring System – No Audible Alert

Supersedes 14-054, dated January 17, 2015, to revise the information highlighted in **yellow**

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2015	TLX	L4 Tech	Check the iN VIN status for eligibility
2015	TLX	V6 2WD Tech	
2015	TLX	V6 SH-AWD Tech	

REVISION SUMMARY

Under **WARRANTY CLAIM INFORMATION**, the layout was clarified for L4 and V6 vehicles.

SYMPTOM

When a vehicle passes behind the 2015 TLX, The Cross-Traffic Monitoring (CTM) alert does not sound. The display screen shows CTM indicators (orange arrows) only.

POSSIBLE CAUSE

The current Combination Meter Unit software does not enable the audible alert for CTM.

CORRECTIVE ACTION

Update the Combination Meter unit software.

SOFTWARE INFORMATION

NOTE: Unnecessary or incorrect repairs resulting from a failure to update the HDS or MVCI are not covered under warranty.

MVCI Control Module (CM) Update:

Application Version **3.01.40 or later**

Database update **12-Nov-2014 or later**

HDS Software Version:

3.015.023 or later

Before beginning the repair, make sure that both the HDS and MVCI are updated as listed above.

Do only the update listed in this service bulletin.

Check that the MVCI indicates the applicable program ID listed below (or a later program ID) as the **Available Update** when the update begins.

If the MVCI displays **This vehicle does not need an update at this time** during the update, the software for this service bulletin is already installed.

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

For more information about updating the HDS, the MVCI, and vehicle systems, refer to Service Bulletin 01-026, *Updating Control Units/Modules*.

Year/Model	Program ID (or later)	Program P/N (or later)
2015 TLX L4, Tech	Z4A120	78109-TZ4-A12
2015 TLX V6, 2WD Tech	Z3A120	78109-TZ3-A12
2015 TLX V6, AWD Tech	Z7A120	78109-TZ7-A12

WARRANTY CLAIM INFORMATION

TLX L4 vehicles only

Operation Number	Description	Flat Rate Time	Template ID	Defect Code	Symptom Code	Failed Part Number
7165A0	Update the Combination Meter unit software.	0.5 hr	14-054N	5JM00	JN400	78100-TZ3-A11

Skill Level: Repair Technician

TLX V6 vehicles only

Operation Number	Description	Flat Rate Time	Template ID	Defect Code	Symptom Code	Failed Part Number
7165A0	Update the Combination Meter unit software.	0.5 hr	14-054P	5JM00	JN400	78100-TZ3-A11
A	Reset the PCM using HDS and do the idle learn procedure (V6 vehicles only)	0.2 hr				

Skill Level: Repair Technician

REPAIR PROCEDURE

1. Update the combination meter unit software with the MVCI. Refer to Service Bulletin 01-026, *Updating Control Units/Modules*.

NOTE: The update cannot be done if the HDS is connected to the MVCI.

2. Connect the HDS to clear any DTCs.
3. *V6 models only*: Reset the PCM using the HDS, then do the idle learn procedure according to the electronic service manual.

END