



# SERVICE BULLETIN

Classification: BT99-055	Reference: NTB00-050	Date: June 8, 2000
-----------------------------	-------------------------	-----------------------

## 2000 FRONTIER CREW CAB DRONE NOISE AT 1,000 ENGINE RPM

**APPLIED VEHICLE:** 2000 Frontier (D22) Crew Cab - 2WD A/T ONLY

**APPLIED VIN:** Vehicles built before 1N6ED27T\*YC414670

### SERVICE INFORMATION

If a 2000 Frontier Crew Cab exhibits a drone noise inside the vehicle during warm-up as the engine speed slowly drops down through 1,000 RPM, use the service procedure listed below to resolve the incident.

### SERVICE PROCEDURE

Install the dynamic damper on the exhaust bracket and tighten the damper mounting nuts to 13 N-m (1.3 kg-m, 9 ft-lb). Refer to Figure 1 below.

**NOTE:** The nuts for mounting the damper are already on the vehicle (i.e., on the exhaust bracket).

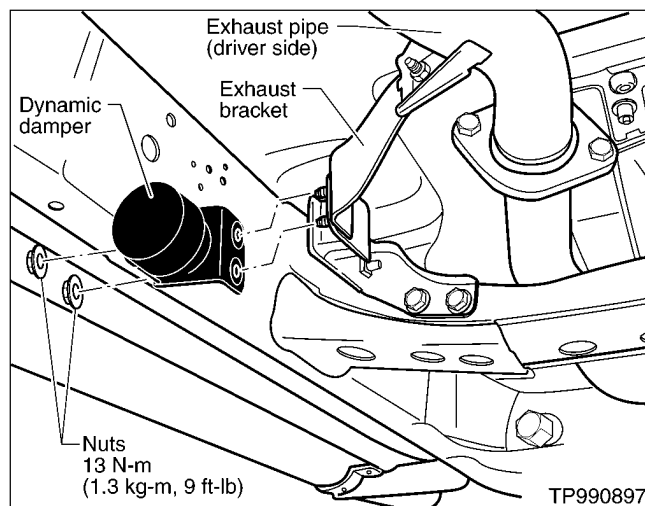


Figure 1

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Insulator, Exhaust Dynamic	20785-9Z300	1

## CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Exhaust Pipe Damper/Insulator	20785-9Z300	FD48AA	ZL	69	0.3 hrs

