



# UI Bulletin #105

**Subject:** Removing/Disabling  
**Rear Park Assist**  
**(RPO UD7)**

**Models:** Chevrolet Silverado/GMC Sierra

**Model Years:** 2007-2013

**Date:** October 9, 2012

**Revision** October 9, 2012

**Date:**

## ADVISORY:

This UI Bulletin is being created using information contained in General Motors  
Technical Bulletin PIT5039a

### Condition/Concern:

Some customers/upfitters may remove the rear bumper, install a different rear bumper, or add a different box/flat bed/cube box/hitch...etc to the rear of the truck, which affects the rear park assist operation.

### Repair/Recommendation:

In these cases, the rear park assist option can be removed from the vehicle. Follow the instructions below for the model year of the vehicle involved:

1. On all model years, disable the Park Assist Module (Note: In most cases removing the OBS DET fuse 20 (10 amp) from the Left I/P fuse block will work).

2a. For 2007-2009 models, contact Techline Customer Support (800-828-6860) to obtain an IPC calibration to disable the option.

2b. For 2010-2012 models, remove power to the IPC for several minutes and then reconnect (disconnecting the battery will work). When power is reconnected the IPC will not see the Park Assist Module on the low speed data buss (because it was disabled in Step 1), thus reconfiguring the IPC without Park Assist. After this is complete there will be no Park Assist Warning Messages displayed.

NOTE: Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

**General Motors Upfitter Integration**

<http://www.gmupfitter.com> • 1-800-875-4742 (Upfitter Hotline)