



**Technical Service
BULLETIN**

August 10, 2001

Title:

M.I.L. "ON" DTC P1133

Models:

'98 - '00 RAV4

T S B

**ENGINE
EG012-01**

Introduction Under certain driving conditions, some 1998–2000 model year RAV4 vehicles may exhibit a M.I.L. "ON" with DTC P1133 (Air Fuel Ratio Sensor Slow Response Malfunction). The A/F sensor has been modified to correct this condition.

- Applicable Vehicles**
- 1998–2000 model year **RAV4** vehicles.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
89467-41020	89467-42030	Sensor, Air Fuel Ratio
89467-41021		

Repair Procedure

1. Should a M.I.L. "ON" condition with P1133 be encountered, perform diagnostic procedures as described in the Repair Manual.
2. If the problem source cannot be identified after checking all affected areas according to the Repair Manual, replace the A/F Sensor with the new part number.

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
895131	R & R A/F Sensor	0.4	89467-41021	72	71

Applicable Warranty*:

This repair is covered under the Toyota Federal Emissions Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date. For California specification vehicles registered and operated in California, Massachusetts or Vermont, this repair is covered under the California emissions warranty, which is 36 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

