


L624-A.07.15	<b>To:</b> Official After Sales Network <b>Subject:</b> Seat update <b>Date:</b> 02/02/15 <b>Pages:</b> 5	
--------------	--	---

## Subject

Seat update

## Model

All Lamborghini Huracán Models MY 15 from VIN **FLA00163** to VIN **FLA01657**.

**Warning:** some vehicles included in this VIN range may not be involved, so check carefully on the Lamborghini WEB Portal (at the section named VIN Info) if the cars in your workshop or in your dealer stock are involved before performing any other operation.

## Information to the field

As a result of continuous product monitoring, Automobili Lamborghini Spa has decided to install a wiring reinforcement to prevent abrasion during seat movement.

## Field solution

Update seats following the herein detailed instructions.

## Spare Parts.


P/N	Description	Q
4T0951195	Sheath	2

## Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

**Campaign Code:** L624-A.07.15  
**Campaign Des.:** Seat update.  
**Cost code:** 50  
**Component code:** CCA0715  
**Trouble code:** 220  
**Labor code:** CCA0715100  
**Labor Time:** 3 h


Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

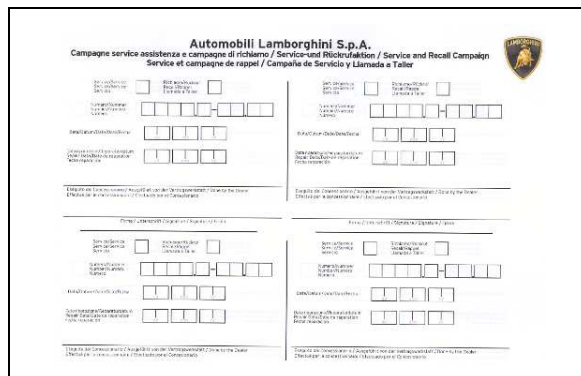

## Instructions


 
## WARNING!



- This procedure must be performed on **driver and passenger sides.**
- The procedure **details the operations on the driver side.**

## preliminary operations.


1. Mount the rocker panels protections before proceeding with the seat removal



Operation to be performed on both sides



Rev.01	<p>The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.</p> <p style="text-align: right;">doc. nr: L/V6_M06 Rev.[02]</p>	1/5
--------	---	-----

L624- A.07.15	<b>To:</b> Official After Sales Network <b>Subject:</b> Seat update <b>Date:</b> 02/02/15 <b>Pages</b> 5	
------------------	---	---


2. Remove the 4 fixing screws securing the seat to the floor (move seat backward and forward to uncover them).

Screw tightening  
Torque: **40Nm  $\pm$  5%**



**Remark**

Operation to be performed on both sides

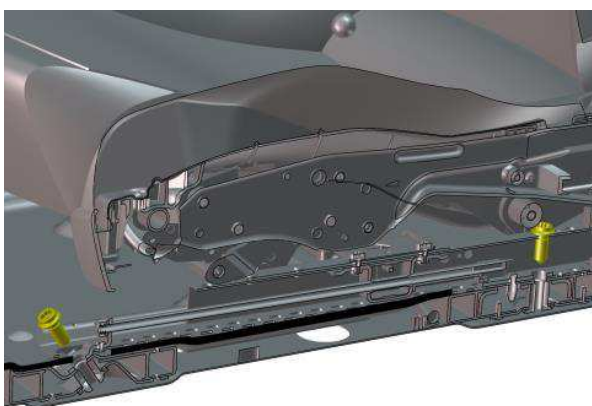


62x15\_0001419

3. Access the battery from the inspection hatch present in the luggage compartment, remove the negative pole cover and disconnect the clamp from the battery negative pole.



**Remark**

Make sure the instrument panel is off before performing this operation.

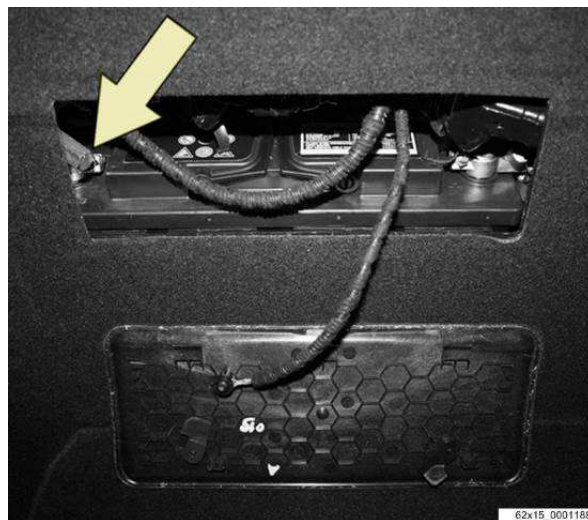


62x15\_0001188

4. Lift the seat, release the wiring and disconnect the connectors.



**Remark.**

Operation to be performed on both sides.

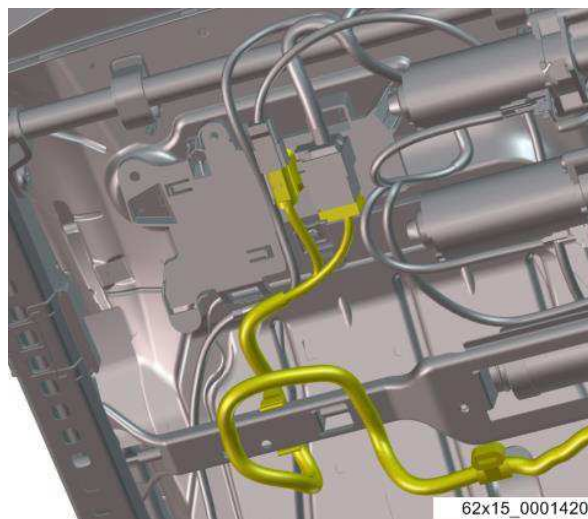

62x15\_0001420


5. Remove the seat from the cockpit.  
Be careful not to damage the cover.



**Remark.**

Operation to be performed on both sides.


Rev.01	<p>The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.</p> <p style="text-align: right;">doc. nr: L/V6_M06 Rev.[02]</p>	2/5
--------	---	-----

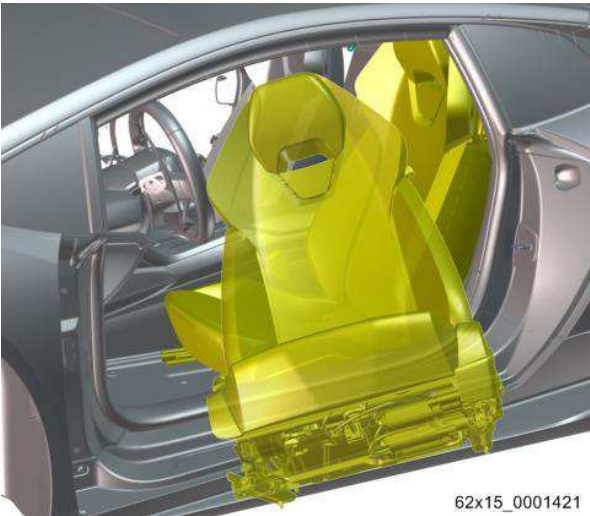

6. Remove the central tunnel soft cover leveraging the points indicated in the figure.
- Use plastic levers avoiding damages to the cover.




**Remark.**  
Operation to be performed on both sides.

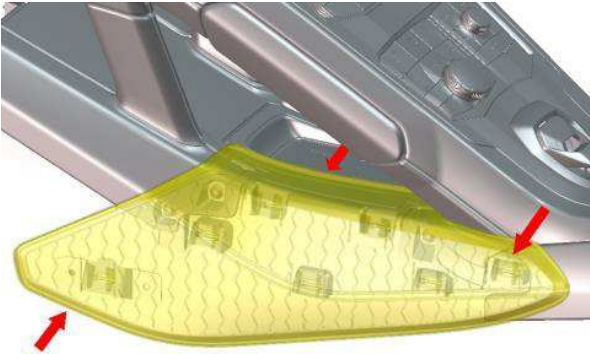

7. Remove the tunnel rear side cover by leveraging the indicated points.
- Use plastic levers and be careful not to ruin the aesthetic finish.




**Remark.**  
Operation to be performed on both sides

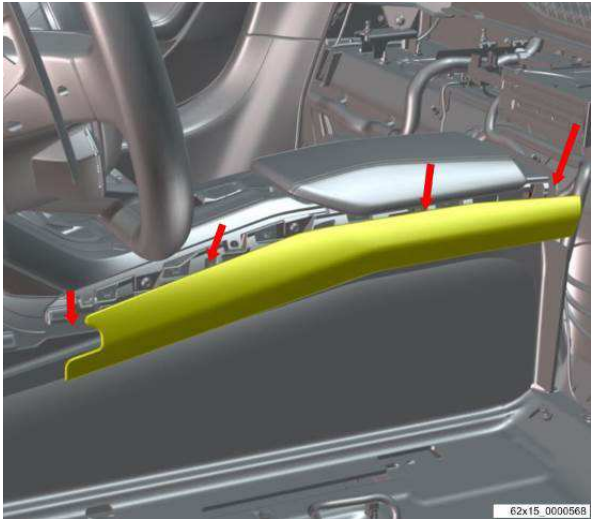


8. Remove the 2 clips that hold the carpet to the tunnel.
- Use plastic levers and be careful not to ruin the aesthetic finish.



**Remark.**  
Operation to be performed on both sides

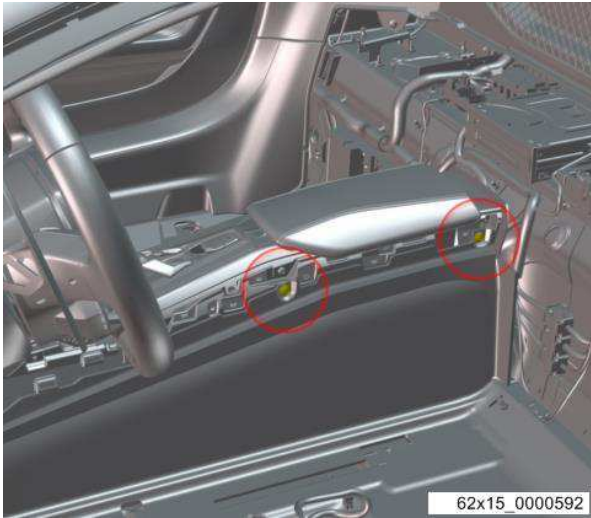



L624- A.07.15	<b>To:</b> Official After Sales Network <b>Subject:</b> Seat update <b>Date:</b> 02/02/15 <b>Pages</b> 5	
------------------	---	---


9. Remove the 3 clips that hold the carpet to the car floor.

Use plastic levers and be careful not to ruin the aesthetic finish.



**Remark.**

Operation to be performed on both sides

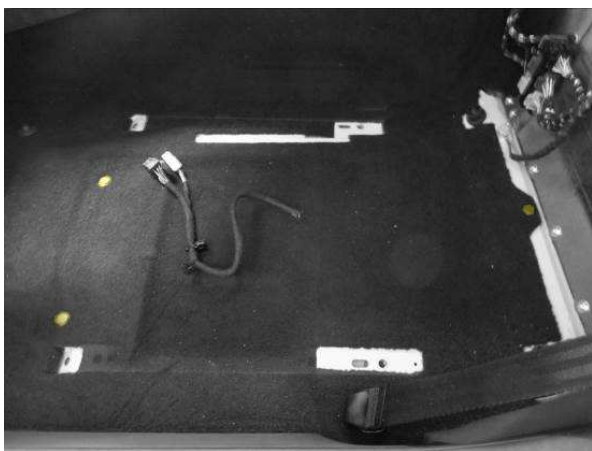

10. Separate the carpet from the central tunnel.

Do not to ruin the sound-absorbing material bonded to the tunnel.



**Remark.**

Operation to be performed on both sides



**Reassembling note.**

Restore the adhesive between the carpet and the sound-absorbing material.



11. Lift the carpet from the car floor and slip off the seat wiring.



**Remark.**


Operation to be performed on both sides



**Changes and update.**

12. Cover the wire on vehicle cockpit platform with the protective sheath.

Rev.01	<p>The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.</p> <p style="text-align: right;">doc. nr: L/V6_M06 Rev.[02]</p>	4/5
--------	---	-----

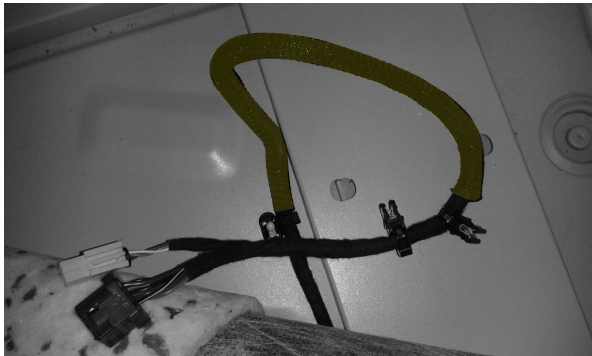

**Remark.**

Operation to be performed on both sides

13. Fix the sheath to the wire by wrapping it with tissue adhesive tape al long its length.




**Remark.**

Operation to be performed on both sides


14. Change routing of the seat belt buckle wiring.

When the buckle wire is placed onto the external side of the buckle stem facing the tunnel, it must be routed again.

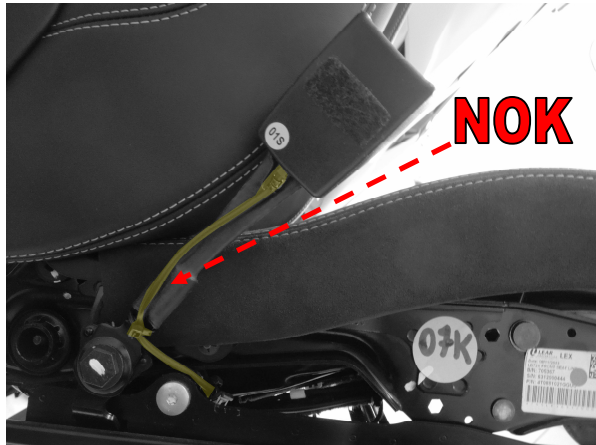

Remove the clamp on the buckle and release the electrical wiring.

Clamp the electrical wiring so that the wire is placed on the thin side of the buckle stem.

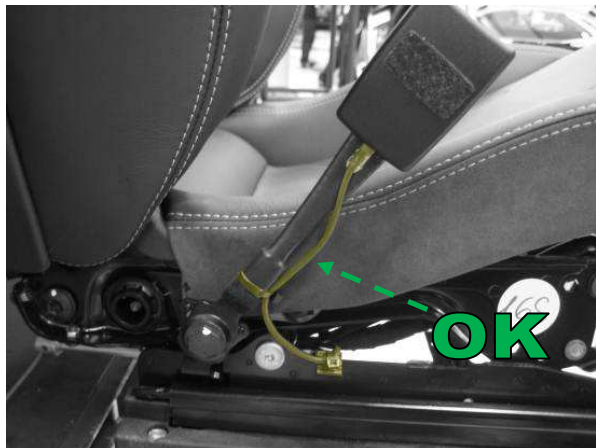

15. Reassembly all parts in reverse order.
16. After having connected the battery execute the Power window self-leaning and then set t the right time and date on vehicle clock.