



To All US and Canadian Lamborghini Dealers and Licensed Service Points
From Customer Service Department
Subject Repositioning of the SDARS antenna
Group 824.0.35
Date 25.11.2008
Pages 5

Automobili
Lamborghini S.p.A.

Subject

Repositioning of the SDARS antenna.

Model/VIN Range

All Murcielago LP 640 Coupès and Roadsters.
From VIN B93254 to VIN B83392 inclusive.

Attention: As not all vehicles from this VIN range are affected, please carefully check on the Lamborghini Web-portal VIN-Info section if the vehicle is affected by this Service Campaign before the start of any updating.

Information to the field

As a result of company's continuous product monitoring, Automobili Lamborghini S.p.A. has found that, in some vehicles, the SDARS could be improperly positioned and a bad audio reception could result. Therefore it may be necessary to reposition the antenna following the instructions in this bulletin.

Spare Parts

None required.





Workshop instructions

- 1.1 Please observe all safety precautions in order to prevent personal injury or damage to the vehicle.
- 1.2 Remove the instrument panel, the left side and the left central air intake (see also workshop manual instructions 08 68 03).
- 1.3 Disconnect the air condition hose (1-Pict.1) in the central zone of the passenger compartment.






1.4 Check the position of the SDARS antenna: incorrect (Pict.2) or correct (Pict.3).

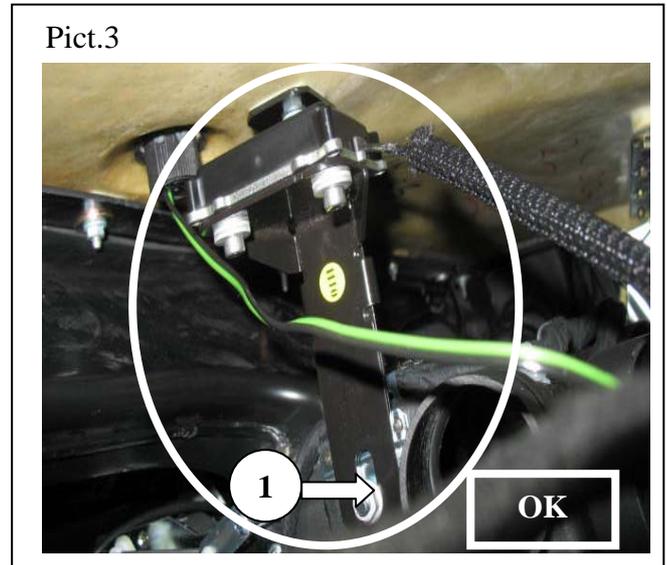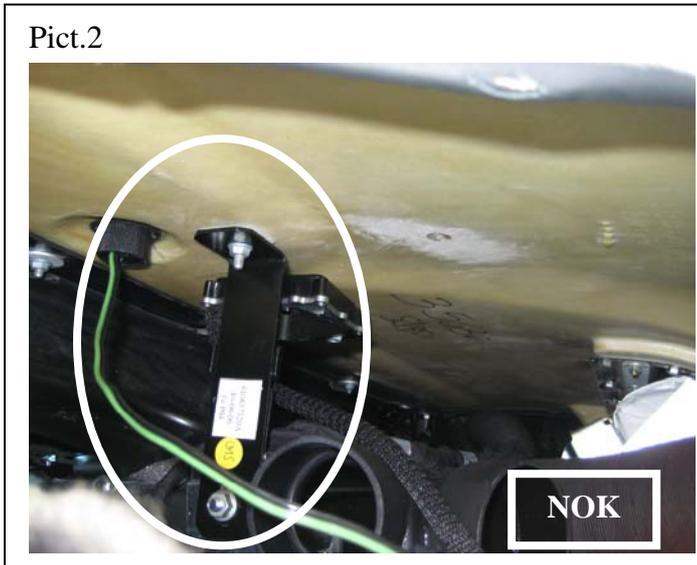


1.5 If the SDARS antenna is in the wrong position (Pict.2), unscrew the bolt (1-Pict.3) and remove the bracket with SDARS antenna (1-Pict.4).

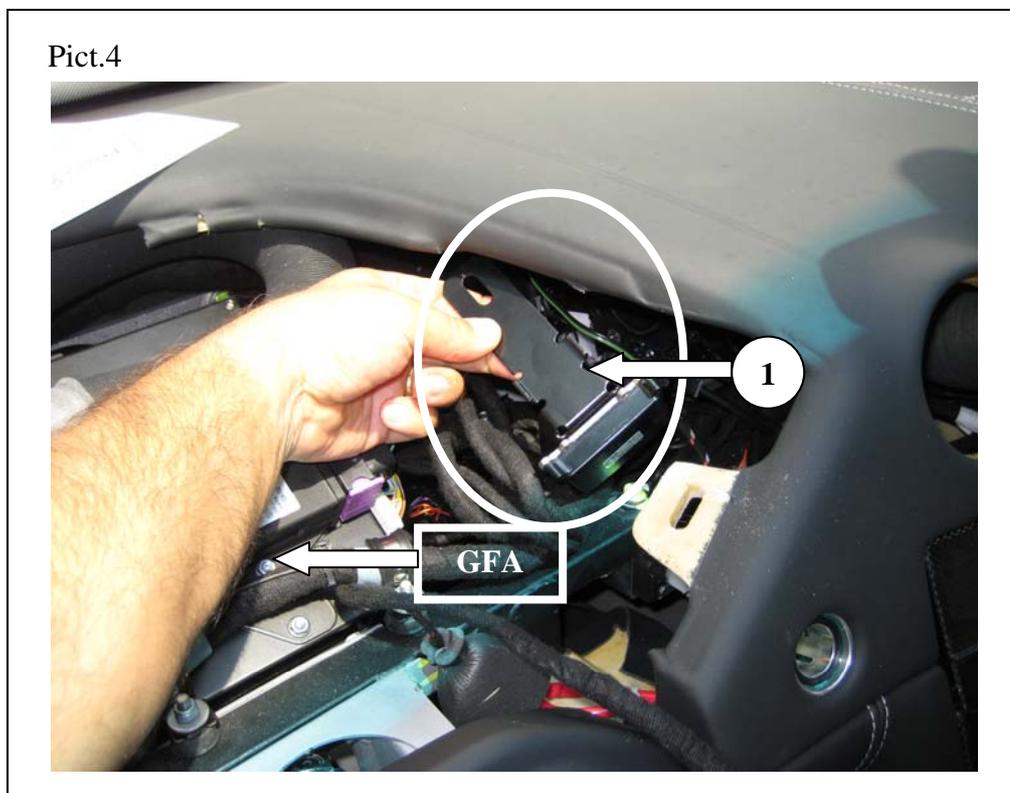

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



- 1.6** The plate of the bracket with the SDARS antenna must to be positioned in front of the GFA ECU (see also the Pict. 3 and 4).

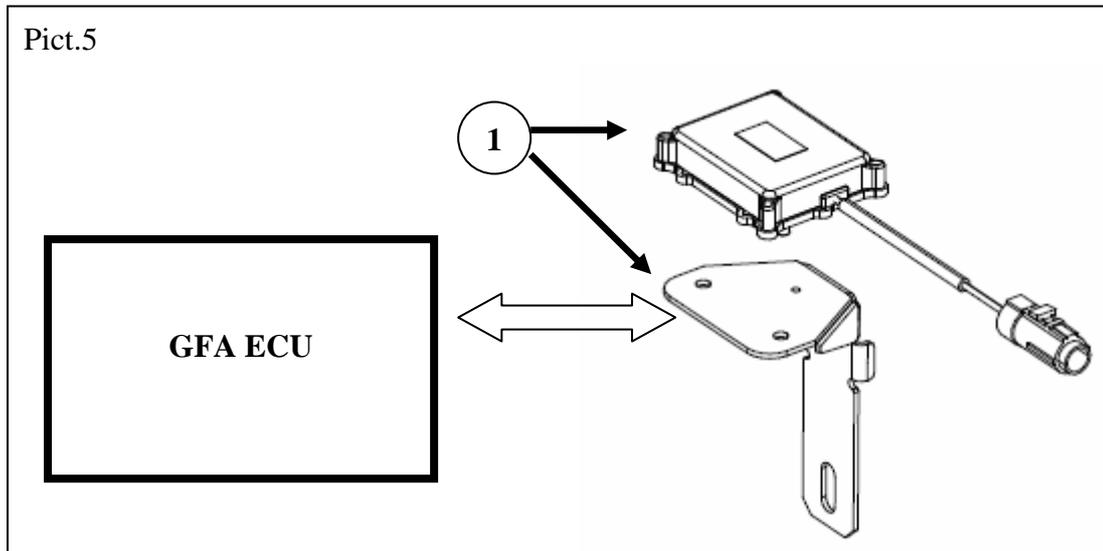

- 1.7** Re connect the air condition hose (1-Pict.1) in the central zone of the passenger compartment.
- 1.8** Reassemble the instrument panel, the left side and the left central air intake (see also workshop manual instructions 08 68 05).

Your Area Manager is at full disposal for further information.

Best regards

Customer Service