

ToAll Lamborghini Dealers and Licensed Service PointsFromCustomer Service DepartmentSubjectSoftware update of the E-Gear ECUGroup824.9.71Date18.11.2008Pages8

Subject Software update of the E-Gear ECU.

Model/VIN Range

All Murcielago LP 640 Coupè and Roadster. From VIN B93254 to VIN B93375 inclusive.

<u>Attention</u>: As not all vehicles from this VIN range are affected, please carefully check on the Lamborghini Web-portal VIN-Info section if the vehicle is affected by this Service Campaign before the start of any updating.

Information to the field

As a result of company's continuous product monitoring, Automobili Lamborghini S.p.A. has found that, in some vehicles, the clutch engagement could be uncomfortable.

This rework action must be also performed on all vehicles in your stock.

Field solution

Follow the workshop instructions in this document for updating of software for the E-Gear ECU.

Spare Parts

None required.

Automobili Lamborghini S.p.A.

Via Modena,12 I-40019 Sant'Agata Bolognese Tel +39 051 6817 652 Fax +39 051-6817 709



Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.

Campaign Code:	L824-A.03.08
	L825-A.03.08
Campaign Description:	Software update of the E-Gear ECU
Cost Code:	50
Component Code:	CCA0308
Trouble Code:	220
Labour Code:	CCA0308100
Labour Time:	0,5 h


Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Servicio Llamada a Taller	Service/Service Richiamo/R0ckruf Service/Service Recall/Rappel Servicio
Numero/Nummer, Number/Numero Número	Numero/Nummer Numero Numero
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Jate/Fecha
Data riparazione/Reparaturdaturn Repair Data/Data de réparation Pecha reparación	Data risanatione/Reparaturdatum Repair Data/Date de réparation Fecho reparación
Esequito del Concessionaria / Ausgeführt von der Vertragsverkstatt / Done by the Bealer Effectué par le concessionnaire / Efectuado por el Concesionario Firma / Unterschrift / Signature / Signature / Firma	Europulio del Concessionario / Ausprührt von der Vertragswertstatt / Done by the Dealer Effectué par le concessionnaire / Efectuado por el Concessionario Firma / Unterschrift / Signature / Signature / Firma
Service/Service Richiamo/Rückruf Recall/Rappel	Service/Service Service/Service Esevice/Service Utamata Taller
Numero/Numéro Número	Numero/Nummer Number/Numéro Nimero
Noniero	and the second se
Deta/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecha




Workshop instructions

- **1.1** Please observe all safety precautions in order to prevent personal injury or damage to the vehicle.
- **1.2** Connect the diagnostic laptop at the car using the Basic XS interface (p/n 66095011) with the black cable (p/n 69190206).
- **1.3** Turn the ignition key to ON position; start the LaRa software and open the Analysis Mode. From the drop down menù (1-Pict.1) select the E-Gear ECU (2-Pict.1) and click the OK button (3-Pict.1).

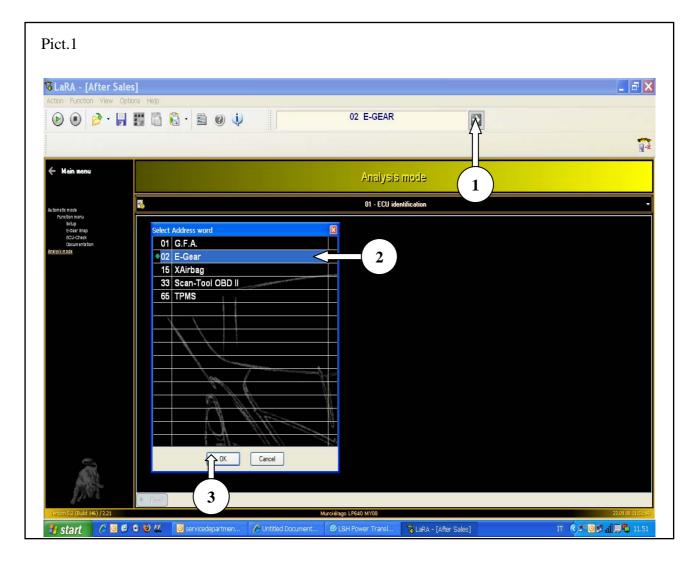




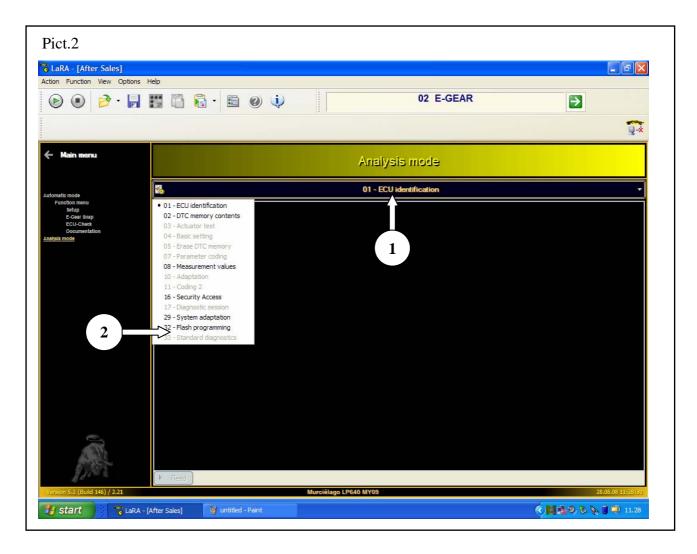

1.4 Select the 01-ECU identification control (1-Pict.2), then select 32-Flash programming (2-Pict.2).



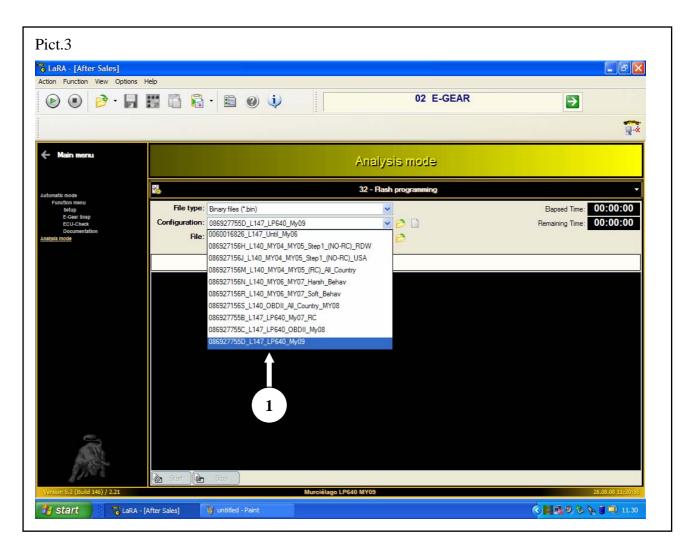

1.5 Select on the drop down menù the configuration 086927755D-_L147_LP640_My09 (1-Pict.3) related to Murcielago MY 09.



LaRA - [After Sales] ttion Function View Opti		• 🖹 🕑 🔃	02 E-GEAR	
Main menu			Analysis mode	
itomatic mode			32 - Aash programming	÷
Function menu setup E-Gear Shap E-CL-Check Documentation aayasis mode	File type: Configuration: File:			Elapsed Time: 00:00:00 Remaining Time: 00:00:00
ersion 5.2 (Build 146) / 2.21	RA - [After Sales]	Stop Murciétago LP	540 MY09	28.06.09 11:92:19 () 11:32:19 () 11:32:

1.6 Select on the drop down menù the 509009880400 file (1-Fig.4) as shown in picture 4.




1.7 Start the communication clicking the icon (1-Pict.5) and after click the Start button (2-Pict.5).

LaRA - [After Sales] tion Function View Optio	ons Help			
		· 🖻 🕑 🌵	02 E-GEAR	€
A ess word: 02 Target 6 Prot. KWP 2000 (5 Ba Baudra 10400	+- 02			
Main menu			Analysis mode	
matic mode	3		32 - Rash programming	•
Function menu Setup	File type:	Binary files (*.bin)	~	Elapsed Time: 00:00:00
E-Gear \$nap ECU-Check	Configuration:	086927755D_L147_LP640_My09		Remaining Time: 00:00:00
Documentation Isls mode	File:	509009880400.bin	ø	
	2			
	Ţ	Stop		
rition 5.2 (Build 146) / 2.21			go LP640 MY09	28.08.08 (11:23767



1.8 Wait for the completion of the software update and select the OK button (1-Pict.6).

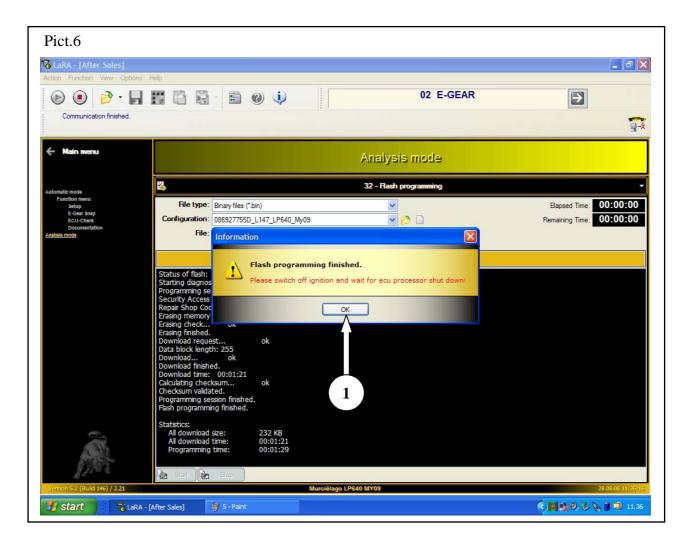

1.9 Turn the ignition key OFF and wait at least 10 seconds before to turning the key to the ON position again.

Your Area Manager is at full disposal for further information.

Best regards

Customer Service