



To All Lamborghini Dealers and Licensed Service Point
From Customer Service Department
Subject New ground fixing point
Group LB824.9.71
Attachments -
Date 12.12.2006
Pages 6

Automobili
Lamborghini
S.p.A.

Subject

New ground fixing point

Model / VIN-Range

Murciélago LP640 from VIN B71805 to VIN B72269.

Attention: Please carefully check on the Lamborghini Web-portal to verify the VIN-Info and if the car is affected by this bulletin before the start of any activity.

Information to the field

There is the possibility that a ground connection in the engine compartment can become rusty.

Field solution

To avoid trouble with electric grounding system and a possible car-down issue, it is necessary to move the ground cable on to a different protected ground fixing point.

Spare Parts

New long stud-bolt: 008300814 available on spare parts catalogue.



Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedure.

Campaign Code: **L824-B.02.06**
Campaign Description: **New ground fixing point**
Cost Code: **55**
Component Code: **CCB0206**
Trouble Code: **220**
Labour code: **CCB0206100**
Labour Time: **1,5 h.**

Automobili Lamborghini will accept a maximum Labour Time of **1,5 h per car.**

Your Area Manager is at full disposal for further information.

Best regards

Customer Service



Necessary material

- 1.1 A stud bolt with code: 008300814 available on spare parts catalogue.

Description of operations

- 1.2 Adopt all precautions to work safe and prevent car damages.
- 1.3 Disassemble the cover grill for the exhaust box as in picture 1.

Pict. 1




- 1.4 Then disassemble the carbon bulkhead on the left side of the engine compartment. The first step is to unscrew the main battery switch (step 1 of picture 2).
- 1.5 Unscrew the four screw on the bulkhead border (step 2 pict.2).



- 1.6** To take out the carbon bulkhead you must disconnect momentarily the hydraulic piston that holds the engine bonnet in the up position (step 3).
Attention: When disconnecting the hydraulic piston from the engine bonnet be careful the bonnet can fall down. Please have an external support on the engine bonnet during this operation.

Pict. 2

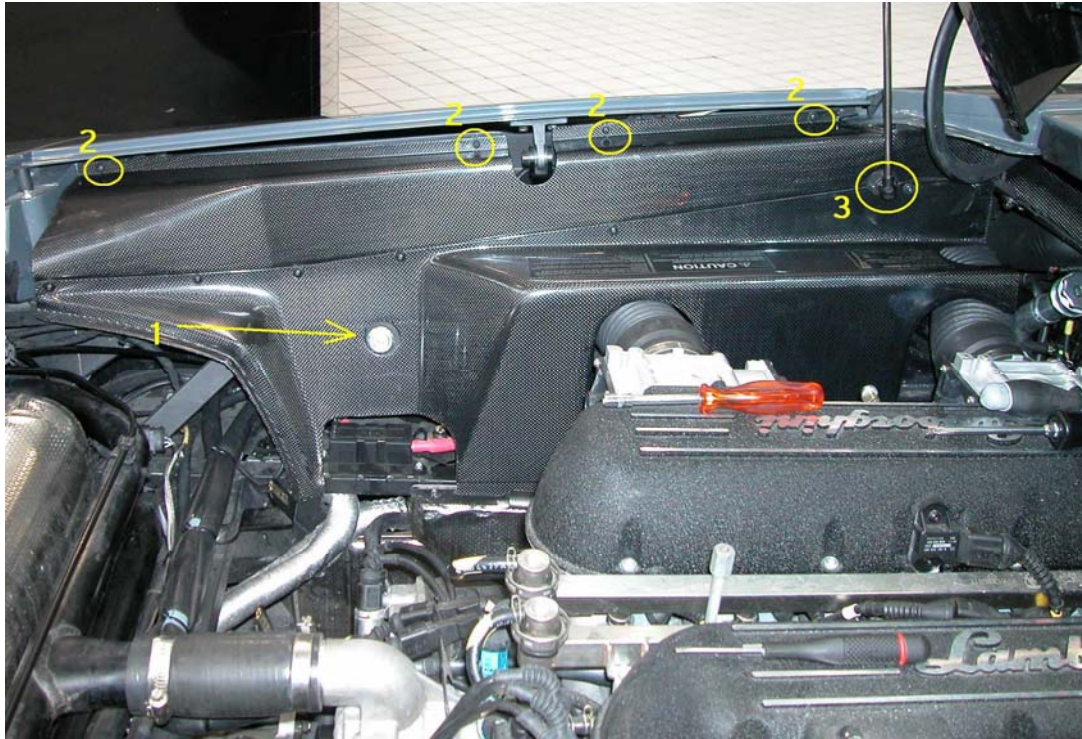


- 1.7** Re-assemble the hydraulic piston after removing the carbon panel to ensure safety while working the compartment area.



1.8 Look at the incorrect ground cable position as shown in picture 3, (reference nr. 1). Please move this cable onto the second ground fixing (reference nr. 2 of pict. 3). To do this you must replace the stud bolt because the old one is not long enough.

Stud bolt code: 008300814


Pict.3

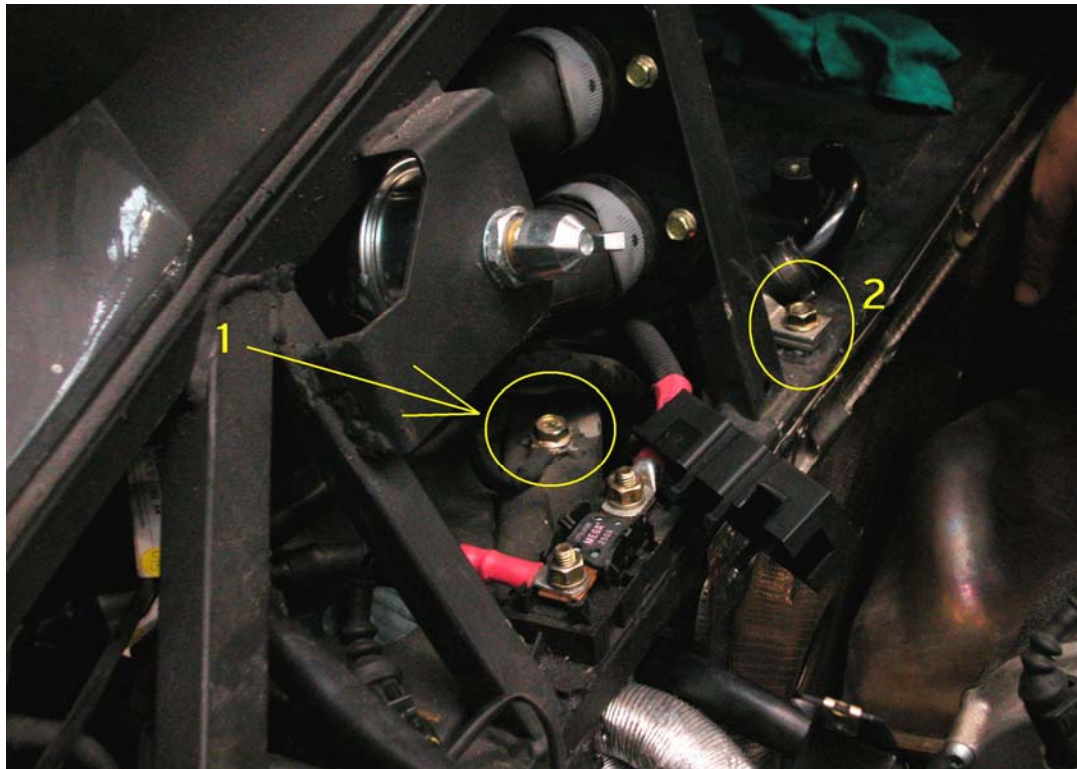

1.9 The cable position should be like shown in picture 4 ref. 1, the small cable will now be installed in the upper position to the other ones.

1.10 If the contact surface of the cable is rusty; remember to clean the connections using sand paper.

Pict.4

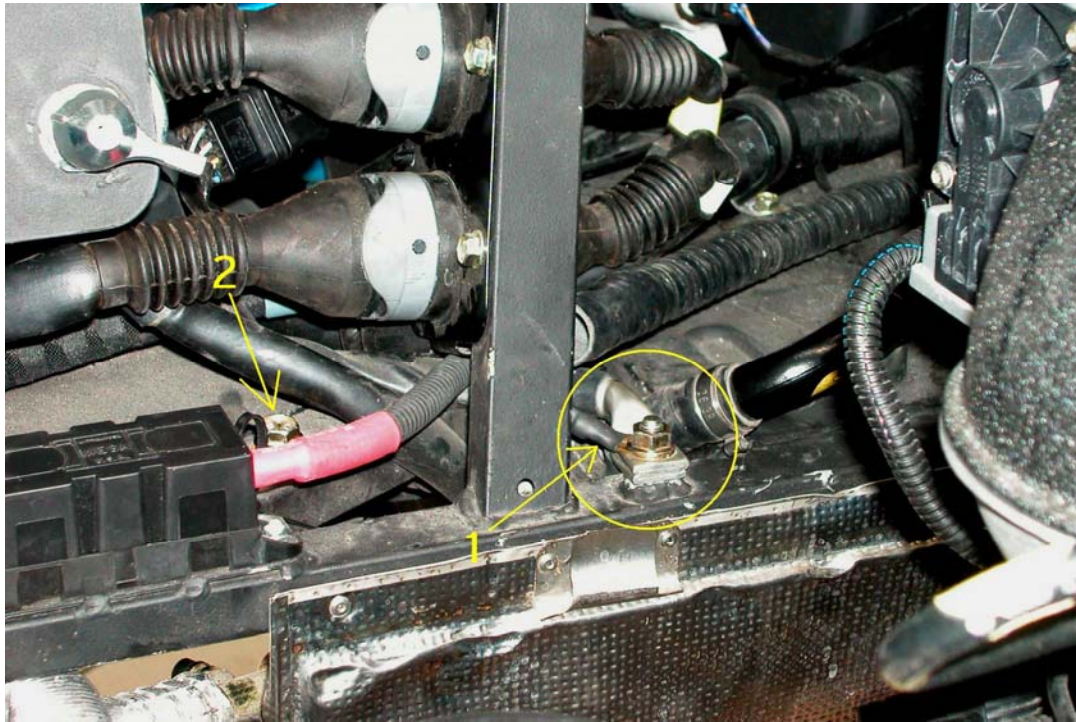

1.11 Reassemble the old screw in the position nr.2 of picture 4.

1.12 Reassemble the bulkhead and the grill.