

To All Lamborghini Dealers and Licensed Service Point

From Customer Service Department

Subject Auxiliary Electric Vacuum Pump Cover

Group 611.01.00 Date 02/08/2013

Pages 5

Subject

Auxiliary Electric Vacuum Pump Cover

Model

All Lamborghini Aventador LP 700 Coupe and Roadster MY 12 and 13 from VIN CLA0091 to VIN DLA01981.

<u>Warning:</u> some vehicles included in this VIN range may not be involved, so check carefully on the Lamborghini WEB Portal (at the section named VIN Info) if the cars in your workshop or in your dealer stock are involved before performing any other operation.

Information to the field

As a result of continuous product monitoring, Automobili Lamborghini Spa has found that on some vehicles the auxiliary electric vacuum pump may develop noise or limited function due to water ingress.

Field solution

Install a cover onto auxiliary electrical auxiliary vacuum pump.

Spare Parts

P/N	Description	Q
470611357	Cover	1

Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.



Campaign Code: L83X-A.02.13

Campaign Description: Auxiliary electric vacuum pump cover

Cost Code: 50

Component Code: CCA0213

Trouble Code: 220

Labour Code: CCA0213100

Labour Time: 0.30 h

Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Service/Service Richlamo/Rückruf	
Service/Service Recall/Rappel Llamada a Taller	Service/Service Richiamo/Rückrul Service/Service Recall/Rappel Servicio Llamada a Taller
Numero (Numero Number (Numero Número	Numero/Nummer Number/Numero Numero
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecha
Data riparazione/Reparaturdatum Repair Data/Data de reparation Fecha reparación Od rum TV	Deta riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación yv
Firma / Unterschrift / Signature / Signature / Firma	Firma / Unterschrift / Signature / Signature / Firma
Service/Service Richlamo/Rückruf Service/Service Recall/Rappel	Service/Service Richlamo/Rückruf Service/Service Recal/Rappel
Servicio Llamada à Taller Numero/Nummer	Servicio Llamada a Taller
Numer of Numbrer Number (Numbrer Number of Numbrer Number of Numbr	Numer of Nummer Number (Numero Numero Numero
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecho
Data riparazione/Reparaturdatum Repair Data/Date de réparation	Data riparazione/Reparaturdatum Repair Data/Date de réparation Fecha reparación od mm yy

The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.



Description of required procedures

Necessary Material

1 Rubber cover (470 611 357)




Disassembly.



The operation herein reported must be performed scrupulously at:

- Engine turned off.
- Ignition key OFF.

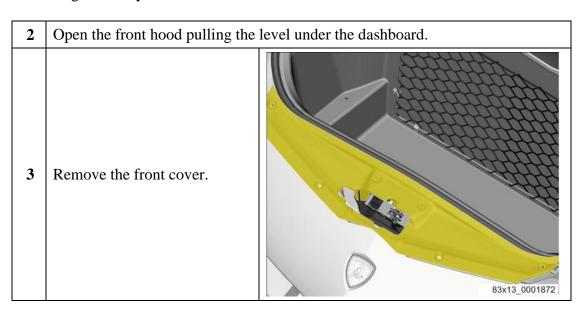





4	Unscrew the 4 screws which secures the trunk. Torque 8 Nm.	83x13_0001902
5	Lift the trunk and disconnect the 12V socket connector.	83x13_0001904
6	Remove the trunk.	83x13_0001905



7 Disconnect the connector of the auxiliary electric vacuum pump.

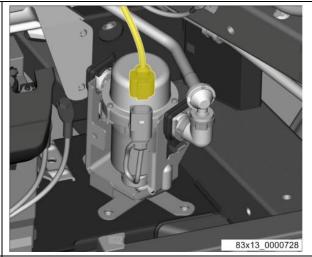

Make pass the connector through the rubber cover and install it onto the pump.

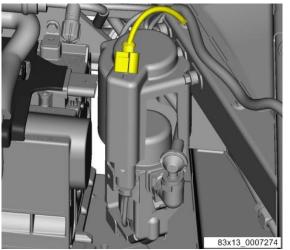

Reassembly

9 Proceed the reassembly in reverse order.

Please contact your Area Manager for any further information.

Yours sincerely

Customer Service.