



This Service Information bulletin supersedes S.I. M64 02 04 **dated August 2004.**

NEW designates changes to this revision

SUBJECT**A/C Does Not Blow Cold Air****MODEL****NEW** R50 (Cooper) with CVT (Automatic Transmission)

Vehicles produced up to August 18, 2004

SITUATION

The A/C line from the condenser to the evaporator is cut by a sharp edge on the CVT oil pan.

CORRECTION


1. **NEW** If the vehicle was produced prior to August 18, 2004 proceed to the next step. For vehicles after the above mentioned production date, before disturbing the routing of the cut hose, take digital pictures from the angles as shown in the attachment, and attach them to a PuMA case.
2. Replace the hose and reposition it so that it does not rub on the oil pan. Refer to Repair Instruction RA64 50 009 (Drawing off, evacuating and filling A/C system – R134a).

ATTACHMENTSview PDF attachment **M640204ACHoseRouting.**

[MINI, a division of BMW of North America, LLC
Copyright © 2005 BMW of North America, LLC]

072292

Picture taken from under the CVT Gearbox oil pan

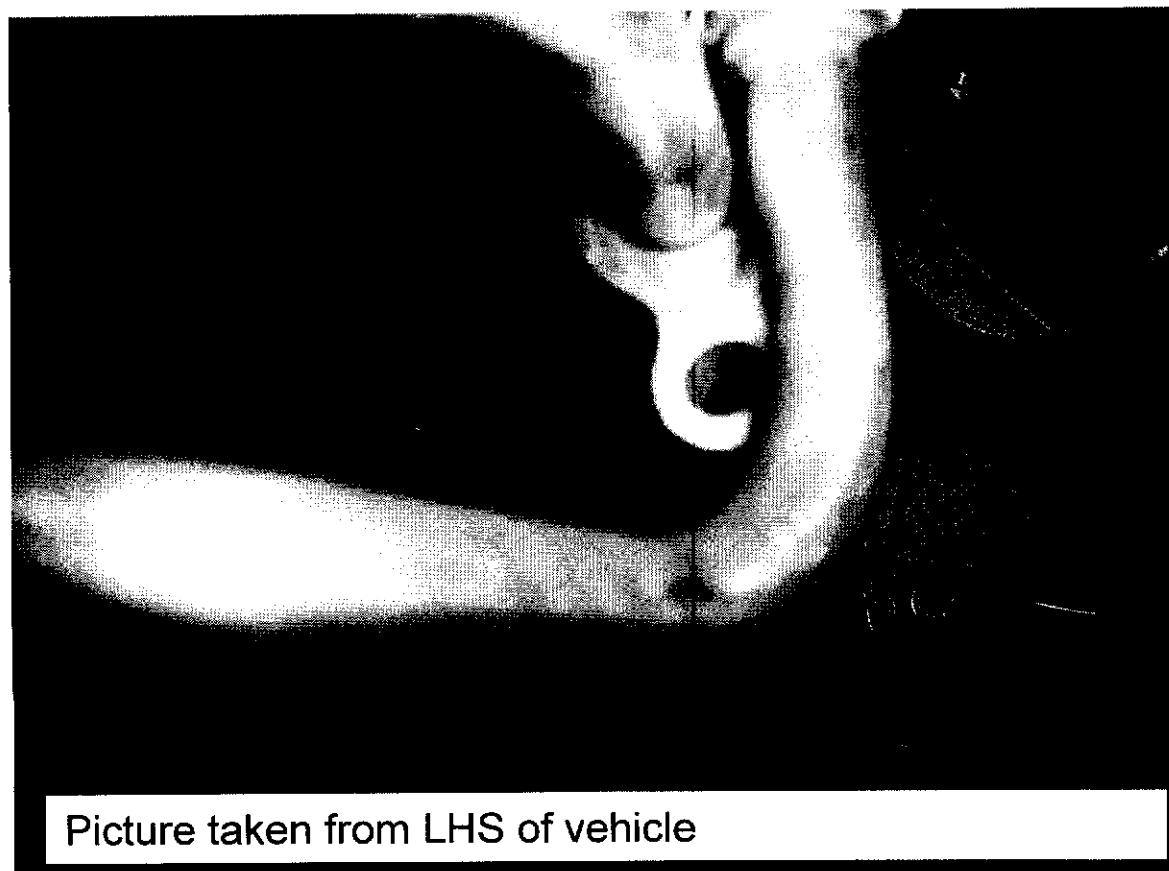

Picture taken from LHS of vehicle