



Service Bulletin

PRELIMINARY INFORMATION

Subject: Rough Idle Or Vibration In Drive

Models: 2014 Chevrolet Silverado 1500
2014 GMC Sierra 1500
Engine 5.3 L83

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

The vehicle may have a rough idle and/or a vibration at idle in gear.
It may also be described as the engine feels like it is idling too slow.
There will not be any DTC with this concern and it will go away just off idle.

Recommendation/Instructions

If this is encountered try centering the engine and trans mount.
If no change then shim the right engine mount to most inner bolts 3mm.
The shims will need to be installed between the mount and the frame.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4067150	Engine Mount Replacement - Right Side	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION