



Service Bulletin

PRELIMINARY INFORMATION

Subject: Dome Lamps Flash/Flicker On and Off when Operating Brake Pedal or Turn Signal

Models: 2015 Cadillac Escalade Models
2014 Chevrolet Silverado 1500
2015 Chevrolet Silverado, Suburban, Tahoe
2014 GMC Sierra 1500
2015 GMC Sierra, Yukon, Yukon XL

Attention: This PI also applies to any of the above models that may be Export vehicles.

This PI has been revised to add the Escalade Models and update Condition/Concerns. This PI replaces PIT5334. Please discard PIT5334 and PI1268.

Condition/Concern 1

Some owners may comment when the dome lamps are off, if the brake pedal is applied or turn signal is operated, the dome lamp will flash on and off. This issue may also occur when other electrical loads are operated, but the brake pedal and left turn signal are the most common. There will be no DTCs related to this issue.

Recommendation/Instructions 1

To correct this concern, replace both front overhead console lamps with GM P/N 23104411.

Parts Information 1

Part Number	Description	Qty
23104411	Front Courtesy Lamp	2

Warranty Information 1

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2080348*	Replace Both Front Overhead Courtesy Lamps	0.4 hr

*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.

Condition/Concern 2 (Excluding Escalade Models)

Some customers may comment on a flicker or pulsing from **bright to dim** when the rear seat entertainment (RSE) reading/dome lamps **are in use** with turn signal or brake activation. This condition will only exist on vehicles with RSE (RPO U42) and incandescent (Not LED) tail lamps.

This condition may be due to sensitivity of the U42 overhead console to normal voltage fluctuations generated with activation of the brake or turn lamps. The standard overhead is tolerant of these voltage changes and therefore is unaffected.

Recommendation/Instructions 2

Important: Do not replace the BCM, U42 overhead console or any other parts in an attempt to solve this lamp flickering condition.

Engineering is aware of this condition and working on a resolution. Once a solution becomes available this PI will be updated.

Customer Information 2

Please communicate to the customer that we apologize for this inconvenience and that General Motors is working on a solution for this concern. Once a solution is available, this PI will be updated with additional details - allowing dealership personnel to contact the customer to schedule a service appointment and repair the vehicle.

Additional SI Keywords:

dome, flick, flicker, flickering, interior, lamp, lamps, light, lights, overhead

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION