

Preliminary Information

PIT5492A Diagnostic Tip - Battery Discharged Overnight

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Lingine.	Transmissions.
Chevrolet	Colorado	2015 - 2018	All	All	All	All
GMC	Canyon	2015 - 2018	All	All	All	All

Supersession Statement

This PI was superseded to update Model Years. Please discard PIT5492.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

The customer may state that the battery is discharged overnight. The technician may duplicate a 150mA to 450mA draw.

Recommendations / Instructions

Inspect X301 (Headliner to Body Harness near the CHMSL) for bent pins as shown below. Repair or replace terminals as needed.

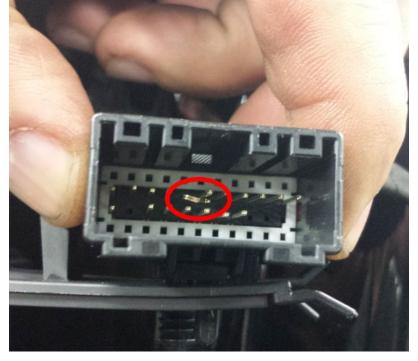

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin <u>10-00-89-005</u> for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

