



Preliminary Information

PIP5411F SES light with DTC's P2635 and/or P018B setting in high ambient temperatures

Product Investigation Review Required

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2016	All	All	6.2L L86	All
Chevrolet	Silverado	2014 - 2017	All	All	4.3L LV3 5.3L L83 6.2 L86	All
Chevrolet	Suburban	2015 - 2016	All	All	5.3L L83	All
Chevrolet	Tahoe	2015 - 2016	All	All	5.3L L83	All
GMC	Sierra	2014 - 2017	All	All	4.3L LV3 5.3L L83 6.2L L86	All
GMC	Yukon	2015 - 2016	All	All	5.3L L83 6.2L L86	All
GMC	Yukon XL	2015 - 2016	All	All	5.3L L83 6.2L L86	All
Involved Region or Country:		North America, Middle East				
Additional RPO/s:		L83 L86 LV3 9C1 FLT				
Condition:		In ambient temperatures 100 F (37.7 C) degrees or higher, DTCs P2635 and/or P018B may set. The vehicle may also exhibit a hesitation or stalling condition.				
Cause:		Vapor buildup in fuel feed line				

Correction:


This PI should only be followed if SI diagnostics have been performed with no solution found.
Replace the in tank fuel pump module assembly with the new design part.

This is a temporary fix and Engineering is working on a permanent repair.

New design

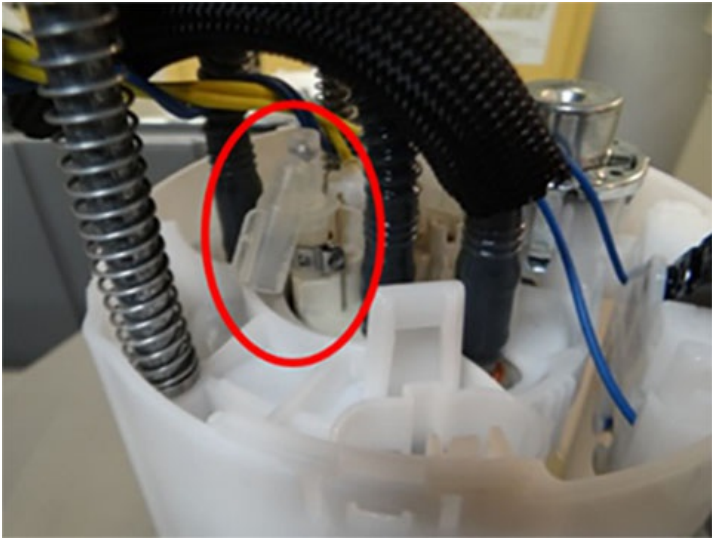

Old design

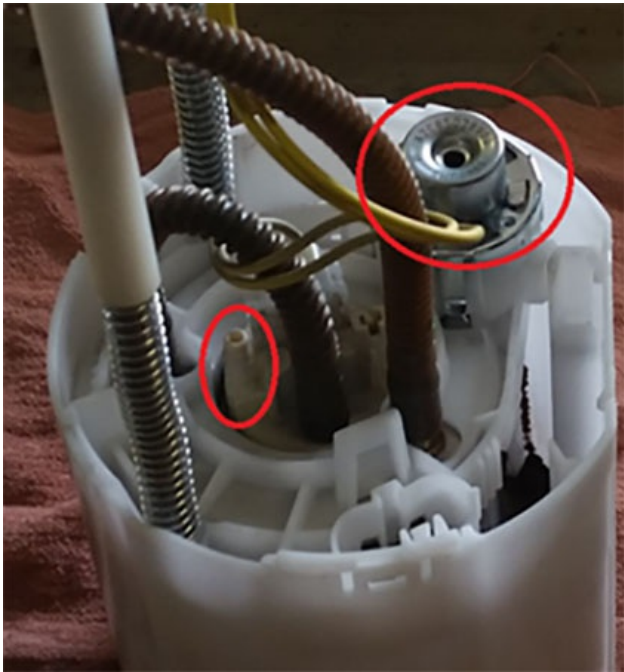

Important: If a new design fuel pump has already been installed and is currently meeting diagnostic pressure specifications, do not install another new design fuel pump in an effort to resolve the condition.

Parts Information

Description:	Part Number:	QTY:
MODULE KIT, F/TNK F/PMP - Short wheel base Utilities	13512934	1
MODULE KIT, F/TNK F/PMP - Long wheel base Utilities	13512935	1
MODULE KIT, F/TNK F/PMP - Short Box Crew Cab Pickups	13513407	1
MODULE KIT, F/TNK F/PMP - Standard Box Regular Cab Pickups	13513408	1
MODULE KIT, F/TNK F/PMP - Long Box Regular Cab Pickups	13513409	1
MODULE KIT, F/TNK F/PMP - Standard Box Crew Cab Pickups	13510918	1

Warranty Information

Labor Operation:	Description:	Labor Time:
4028730	Fuel Tank Fuel Pump Module Replacement	Use Published Labor Time

Version History

Version	7
Modified	8/24/2016 To include Cadillac Escalade, Chevrolet Suburban, GMC Yukon and GMC Yukon XL models and to add time sensitive investigation instructions. 8/31/2016 to include instructions for replacing the fuel pump module. 10/10/2016 To include Middle East as an involved region. 7/17/2017 to include reference to latest version of PIP5507 if condition still present after fuel pump replacement. 10/10/2017 to include 2014-2017 Chevrolet Silverado, 2014-2017 GMC Sierra and add photos of the new and old design fuel pumps. 10/16/2017 to update correction information.