



Preliminary Information

PIT5301B False B127E Set In HMI Module

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	LaCrosse	2014 - 2017	*See Note	*See Note	All	All
Cadillac	SRX	2013 - 2016	*See Note	*See Note	All	All
Cadillac	XTS	2013 - 2017	*See Note	*See Note	All	All
Cadillac	Escalade	2015 - 2017	*See Note	*See Note	All	All
Chevrolet	Silverado	2015 - 2017	*See Note	*See Note	All	All
Chevrolet	Suburban	2015 - 2017	*See Note	*See Note	All	All
Chevrolet	Tahoe	2015 - 2017	*See Note	*See Note	All	All
GMC	Sierra	2015 - 2017	*See Note	*See Note	All	All
GMC	Yukon	2015 - 2017	*See Note	*See Note	All	All

*Note: Equipped with RPO U42 or UWG

Supersession Statement

This PI superseded to add 2017 Model Year, please discard PIT5301A.

Condition / Concern

When performing diagnostics on the infotainment system technicians may find DTC B127E set as a current or history code in the HMI.

Recommendations / Instructions

When a DVD is playing on the front radio display B127E will set as a false current code. Please ignore DTC B127E unless the code stays current after ejecting the DVD.

Important: B127E will show as a history code if the DVD is ejected or if the video is not playing on the front radio display.

